

V O L V O

Volvo Car USA LLC

Technical Journal

Technical Journal Title Rumbling Noise From ERAD / TVDC		Ref. No. TJ 37140.5.1	
Issuer (Dept.) Technical Service		Issue Date 7/18/25	Status Date 7/18/25
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA	Function Group 4601	
Function Description Rear axle, complete		Page Page 1 of 2	

Attachment

File Name	File Size
TJ-37140_1.mp3	0.8486 MB

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

*Vehicle Report section updated.

A customer may experience a rumbling noise from the rear of the vehicle when driving. This noise may be most noticeable at full steering angle and low speeds.

Listen to the attached sound file, TJ-37140_1.mp, as an example of this noise. (The noise is heard at 5 and 26 seconds in the recording)

Please follow the advice under "Service".

ERAD - Electrical Rear Axle Drive

TVDC - Torque Vectoring by Dual Clutch

CSC Customer Symptom Codes

Code	Description
8N	Driving/Unusual noise/Unsure when/at all times
D2	Front/rear axle/Unusual noise

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
356	E2	E400V13					2025-2026		-	202417-202546
356	EV	E400V3					2025-2026		-	202417-202546

Technical Journal 37140.5.1

SERVICE:

Note: Follow this journal and the steps below before replacing any parts.

- *1. Perform the script “Reconditioning of the Torque Vectoring Friction Plates” and test drive according to VIDA.
(Path to script: Planning and Diagnostics / Components / ECUs / Torque Vectoring Rear Left (TVRL) / Diagnostic Sequences / Reconditioning of the torque vectoring friction plates.)
If the rumbling noise still occurs after completing the script, continue to step 2.
2. Replace the TVDC according to VIDA.

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Note that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
31130-2	High voltage battery disconnect and connection
26151-3	Cooling system electric powertrain, fill and bleed
36060-3	Calibration with VIDA
36100-2	Test drive acc. to Technical Journal
46562-2	TVDC, replacement

VEHICLE REPORT:

Yes, please submit a Vehicle Report per TJ 37195.

If the service solution described in this TJ **has no effect** use the sub-concern area “**Support Needed**”, and use function group 4601.

If TVDC replacement fixed the concern, use the sub-concern area “**Support Not Needed**”, and use function group 4601.

To view TJ attachment continue to next page. This TJ has one sound file.