



## STAR ONLINE PUBLICATION



**Case Number:** S2508000067

**Release Date:** August 2025

**Symptom/Vehicle Issue:** Key Fobs Only Work When Depressing the Key Fob Into the Keyless Ignition Node (KIN)

**Technician Observation:** After replacing the Radio Frequency Hub (RFHUB) the keyless functions for the FOBIK no longer operate as normal, no passive entry or keyless go functions operate. The vehicle does start but will only start by depressing the key fob into the KIN.

**Discussion:** When replacing the RFHUB after performing the RFHUB replacement process, use the scan tool and perform the "Disable Fobik" procedure. Follow all the scan tool directions to program the keys successfully.

### RFH

Radio Frequency Hub

Flash

DTCs

Data

Misc Functions

System Tests

Actuators

Details

Configuration

#### NAME

Clear events log to Passive Entry, Remote Control and Uconnect

Clear TPM Sensor Audit

Clear TPM Sensor Warnings

Disable Fobiks 



### Disable KEYS/FOBIKS

This procedure allows to disable the KEYS/FOBIKS not acquired during the procedure itself. The KEYS/FOBIKS not available during the storage procedure will be temporarily disabled but will be possible to enable them again using the "Enable KEYS/FOBIKS" procedure.

Cancel

Continue

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**