

Subject: Oil Leak from Top of Engine

Brand:	Model:	Model Year:		Build Date:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2025	2025			LK0	
Chevrolet	Traverse	2024					
GMC	Acadia						

In-volved Region or Country	North America, Middle East
Con-dition	Some customers may comment on an oil leak from the front/top of the engine. Some technicians may comment on seeing an oil leak near the engine timing chain upper cover.
Cause	This condition may be caused by the intake camshaft position actuator magnet gasket seal rolled during installation at engine factory causing oil leak.

Cor-rec-tion	
---------------------	--

6389603

Replace camshaft position intake actuator magnet gasket (3).

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to [Camshaft Position Intake Actuator Motor Replacement](#).

Parts Information

Note: Only select the parts that coincide with the repair performed. Replace the part with the P/N outlined in the Electronic Parts Catalog (EPC) in accordance with the vehicle VIN.

Note: Follow the procedure in SI for additional parts that may be required for the repair.

Causal Part	Description	Part Number	Qty
X	SEAL-TMG BELT FRT UPR CVR	12704570	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4121100	Camshaft Position Intake Actuator Motor Replacement	Use the Published Labor Operations Time

Version	1
Modified	Released May 05, 2025