



# Service Bulletin

Bulletin No.: PIP6079

Date: August, 2025

## PRELIMINARY INFORMATION

**Subject: Diagnostic Tip - GDS2 Misfire Detection Data Parameters Not Incrementing Up RPO LSD**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2025 - 2026		All	All	1.5 LSD	All
GMC	Terrain	2025 - 2026		All	All	1.5 LSD	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Information for potential lack of misfire data.
<b>Cause</b>	When performing diagnostics for misfires (P050D or P0300) there is potential that even with a misfiring cylinder we may see all 0's in our GDS2 session log. This can potentially be due to the fact that DTC's were cleared prior, the ECM unplugged (for example when doing an AFIT test) or disconnecting the battery.

### Correction

This requires the vehicle to be driven one complete drive cycle before the next GDS2 session for misfires can be reviewed.

<b>Version</b>	1
<b>Modified</b>	08/06/2025 created on.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



**WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION**

Copyright 2025 General Motors. All Rights Reserved.