



Service Bulletin

Bulletin No.: PIT6106A

Date: August, 2025

PRELIMINARY INFORMATION

Subject: Forward Collision Alert Indicator On At All Times

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT5	2020 - 2025		All	All	All	All
Cadillac	XT6	2022 - 2025		All	All	All	All

Involved Region or Country	North America
Condition	A vehicle may be encountered with the forward collision alert indicators illuminated when they should not be. It may be found that the indicator is on whenever the ignition is on. It may be found that the indicator comes on when the headlights are turned on.
Cause	The harness to the P43 Collision Alert Indicator may be pinched between the cowl and the dash tie bar causing the circuits to short together or to ground.

Correction

Remove the instrument cluster hood- see SI for removal procedure.

Remove the P43 collision alert Indicator

Looking down between the cowl and the dash inspect the harness to the P43 for being pinched between the cowl and the large tie bar that goes across the instrument panel carrier.

It may be necessary to move the sound deadening material on the cowl to see the harness.

It may be necessary to follow the harness down with a hand to help locate the direction the harness follows and the area that it is pinched.

If the harness is found to be pinched or damaged, remove components as needed to gain access to the area and repair it as necessary following wire repair procedures in SI.

Version	2
Modified	01/03/2024 - Created on. 08/08/25- Updated Model Years.

