



Service Bulletin

Bulletin No.: PIT6422


Date: August, 2025

PRELIMINARY INFORMATION

Subject: Unable To Activate Night Vision Camera During a Learn

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CELESTIQ	2024-2026		All	All	All	All
Cadillac	Escalade	2021-2026		All	All	All	All
Cadillac	Escalade ESV	2021-2026		All	All	All	All
Cadillac	Escalade IQ	2025-2026		All	All	All	All
Cadillac	Escalade IQL	2026		All	All	All	All
Cadillac	VISTIQ	2026		All	All	All	All
GMC	Yukon	2024-2026		All	All	All	All
GMC	Yukon XL	2024-2026		All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	RPO UV3
Condition	<p>Some vehicles equipped with the Night Vision System along with any of the DTCs below, may have an issue when attempting a TLC/SPS Night Vision Camera Learn. In some instances, the vehicle's Night Vision camera cannot be activated, and the technician may select "No" at the below screen since the Night Vision button is greyed out in the vehicle</p> <ul style="list-style-type: none">• B1AE5 4A - Night Vision Camera Incorrect Component Installed• B1AE5 76 - Night Vision Camera Wrong Mounting Position• B0124 4A - Night Vision Camera Incorrect Component Installed• B0124 76 - Night Vision Camera Wrong Mounting Position• U3000 54 - Control Module Missing Calibration
Cause	Engineering is aware of the issue and looking to make updates.

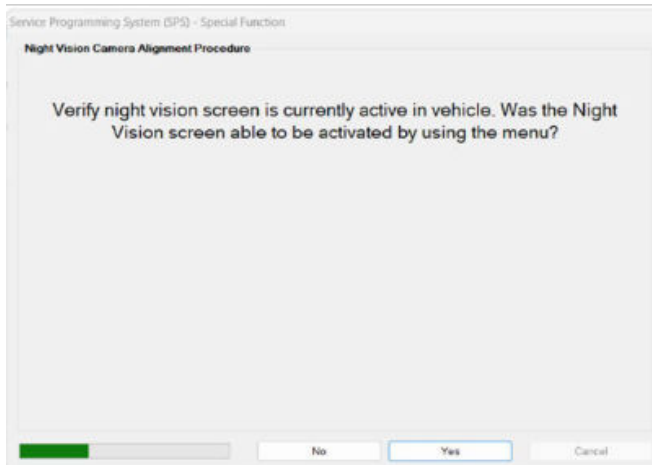


6991210

Correction

In the meantime, use the following as a work around:

- 1) When at the above screen, select "Yes". The following screen should appear:

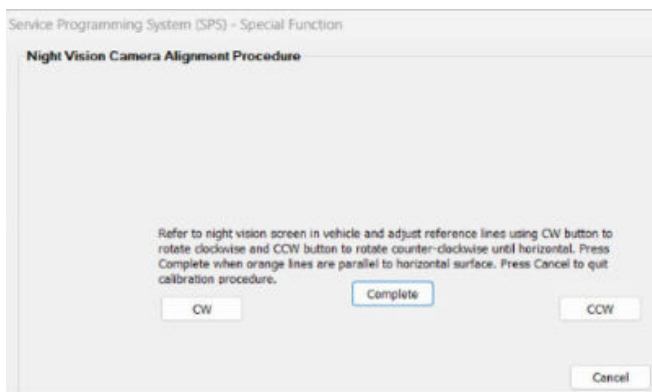

6990635

- 2) Select CW two times and then select "Complete".
- 3) Finish the learn procedure.
- 4) Clear DTCs.
- 5) Repeat the Night Vision Camera Learn again. This time the screen should be allowed to be activated in the vehicle and the learn can be completed successfully

Version	1
Modified	08/07/2025 – Created on.

