



Technical Service Bulletin

GROUP CAMPAIGN	NUMBER 25-01-055H
DATE AUGUST 2025	MODEL(S) IONIQ 9 (ME1A EV)


SUBJECT: PAINT PEELING ON LEFT REAR BUMPER UPPER GARNISH
(SERVICE CAMPAIGN TDZ)

★ IMPORTANT

Dealers must perform this service campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

Access the “Vehicle Information” screen via WebDCS to identify open campaigns.

Description: Certain IONIQ 9 (ME1A EV) vehicles may exhibit paint peeling from the left upper garnish on the rear bumper. This bulletin provides instructions to replace the left upper garnish on the rear bumper.

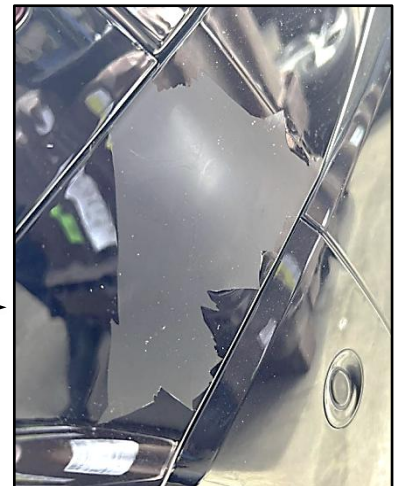



Applicable Vehicles (Certain):

Model Year	Model	Production Dates
2026	IONIQ 9 (ME1A EV)	03/06/2025 – 06/02/2025

NOTICE

To avoid any potential damage to IONIQ vehicles, this service campaign can only be performed at IONIQ certified dealers.

SUBJECT: PAINT PEELING ON LEFT REAR BUMPER UPPER GARNISH (SERVICE CAMPAIGN TDZ)**Parts Information:**

Model	Part Name	Part Number	Figure	Remarks
IONIQ 9 (ME1A EV)	Garnish-RR Bumper Side, LH	866G3-TD100		Qty: 1
	Clip	14206-08250B		Replace if broken

NOTE: Dealers will be reimbursed via sublet as noted below for any clips, regardless of replacement.

Warranty Information:

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
IONIQ 9 (ME1A EV)	50DV16R0	Left Rear Bumper Upper Garnish Replacement	0.5 M/H	866G3-TD100	A42	ZZ2

NOTE 1: Submit claim on Claim Entry Screen as “Campaign” type.

NOTE 2: If a part is found in need of replacement while performing this campaign and the affected part is still under warranty, submit a separate claim using the same repair order. If the affected part is out of warranty, submit a Prior Approval request for goodwill consideration prior to performing the work.

NOTE 3: This TSB includes repair validation photos. Op times include VIN, mileage, and repair validation photo(s) as outlined in the Digital Documentation Policy.

NOTE 4: The incident parts are subject to callback through the normal Warranty Technical Center (WTC) parts return process. **Claim is subject to debit if the part is not returned.**

NOTE 5: Replacement op. code 50DV16R0 will reimburse \$1.00 in sublet for any clips that need to be replaced as a part of the left rear bumper upper garnish replacement.

Service Procedure:



DIGITAL DOCUMENTATION




This TSB includes repair validation photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

Left Upper Garnish Rear Bumper Replacement


1. Open the tailgate.
2. Remove the LH rear combination lamp (A) by referring to the shop manual:
 - **Body (Interior / Exterior / Electrical) > Light & Vision System > Rear Combination Lamp > Removal and Installation**
3. Remove the indicated clip and screws on the left side of the rear bumper.

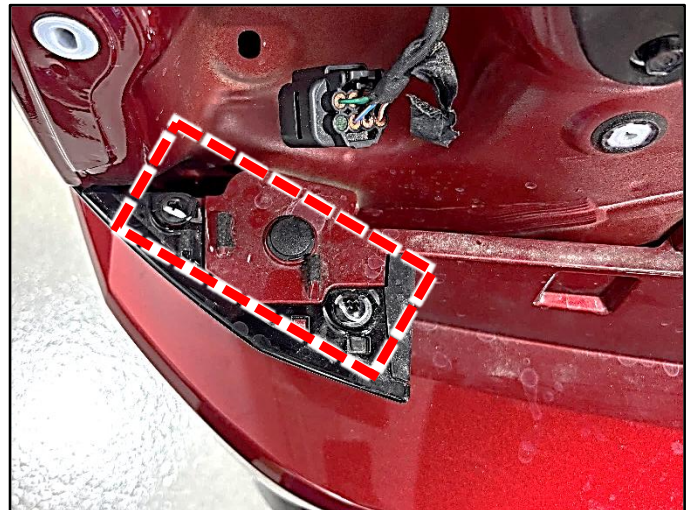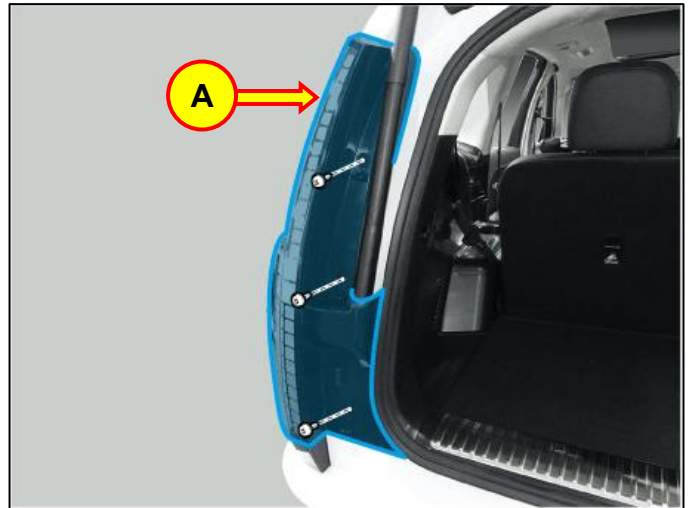


4. Remove the indicated clips from the left side of the rear under cover.

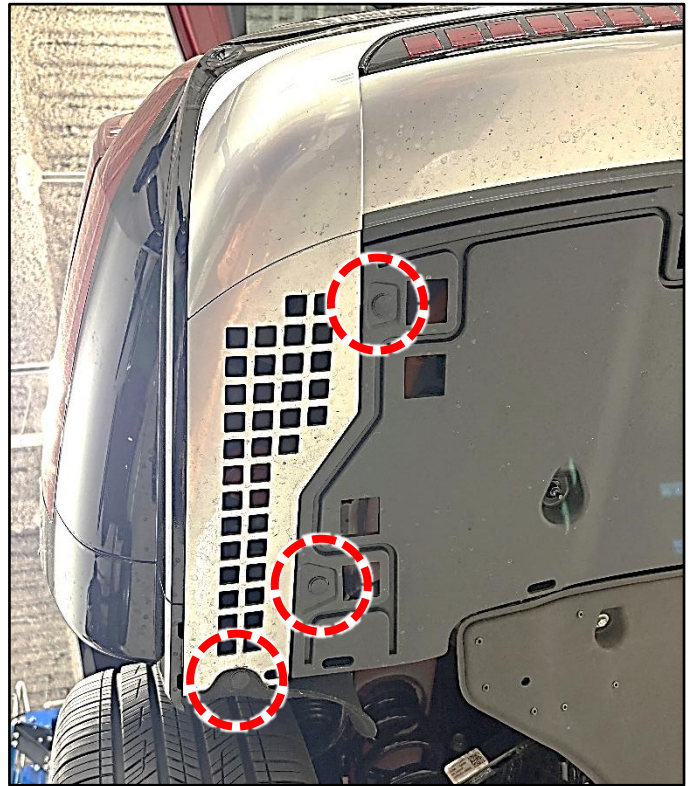


5. Remove the screws as shown in the photo, then detach the left side of the rear bumper (B).

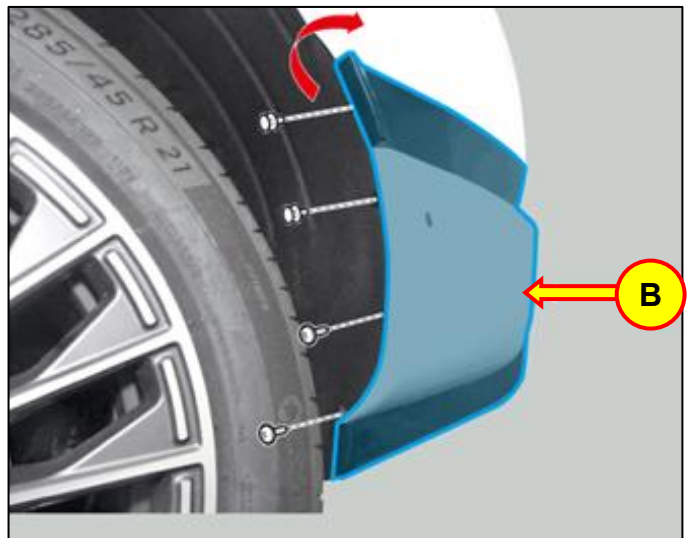

6. Remove the indicated screw and bolts on the backside of the rear bumper.

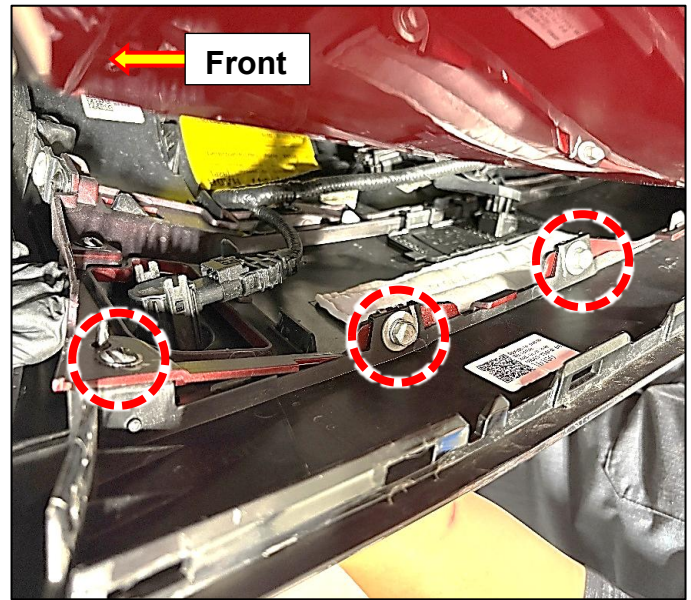

7. Separate the rear bumper side molding (C) from the rear bumper upper garnish (D).

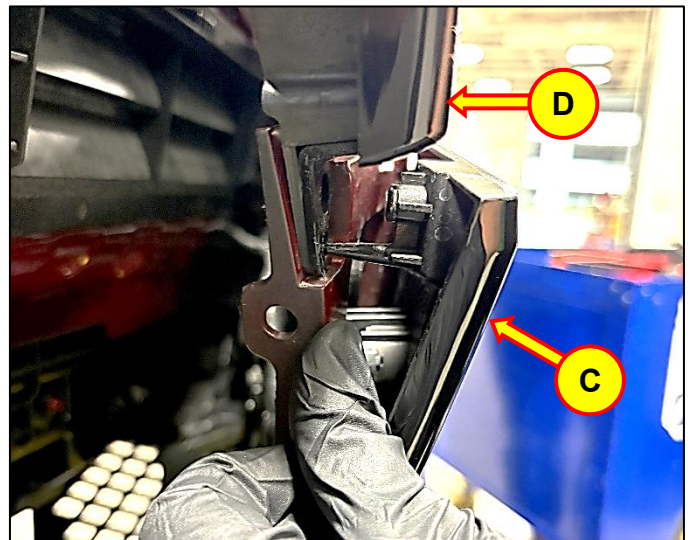

8. Disconnect the indicated locking tabs then remove the left upper garnish (E) from the rear bumper.



9. Install the new left upper garnish onto the rear bumper.
10. Reinstall all parts in the reverse order of the removal process.

- 11.

DIGITAL DOCUMENTATION



Using STUI, take a photo of the new left rear bumper upper garnish with the last 6 digits of the VIN and the date of repair on a piece of paper.

Upload the photo to STUI.



12. The service procedure is now complete.