



SSM 54172 2023-2025 F-Super Duty - Multiple Warning Indicators With DTCs U0252, U0137, U0199, U0438 Stored In The BCM, IPMA, PSCM, IPC And/Or Inoperative Power Windows And Locks

Some 2023-2025 F-Super Duty vehicles may exhibit multiple warning indicators with DTCs U0252, U0137, U0199, U0438 stored in the body control module (BCM), image processing module A (IPMA), power steering control module (PSCM), instrument panel cluster (IPC) and/or inoperative power windows and locks. This may be due to an incorrectly tightened ground 201 (G201). Inspect G201 for proper connection, locating tab insertion, and tighten to 8 Nm (6 lb-ft). If the condition remains after tightening G201, continue with normal Workshop Manual diagnostics outside of this article. For claiming, use causal part 14A005 and labor operation MT14A005SSM up to 1.0 hours.