

## GPOP - Issue Review System

**Part Number:** 68624580A\$, 68624582A\$, 68707768A\$, 68707769A\$

**Part Description:** Door module frt rt

**Issue** Technician Observation:

**Description:** Do not replace Door Control Modules (PDM/DMRL/DMRR) or Latches if any of these DTCs show up as stored/lamp off and clear DTCs. DTC 0x980512 (B1805-12) Passenger Door Lock/Unlock Switch-Circuit Short to Ground DMRL/DMRR:  
DTC 0xA5662A (B2566-2A) Pawl Switch - Signal Stuck DTC 0xA5652A (B2565-2A) - Primary Ajar Switch  Stuck DTC 0xA50007 (B2500-07) Power Sliding Door Latch-Mechanical Failures No impact to customer. Known stored or active faults where no functional effects are observed due these DTCs. But Continue with Normal diagnostics if any functional issues observed (or) If there are other active DTCs logged.