

 Connection offline

Vehicle-specific service

| | |
|------------------------|---|
| Topic | 37 PSS Gearbox warning lamp, drive system fault with DTC P060A00; P1FD700 |
| Market area | United States 444 Volkswagen of America, Inc. (6444) |
| Brand | Audi |
| Transaction No. | 2079003/3 |
| Level | EH |
| Status | Released for publishing |
| Release date | Aug 29, 2025 |

Vehicle data

B10

Sales types

| Type | MY | Brand | Designation | Engine code | Gearbox code | Final drive code |
|------|------|-------|-------------|-------------|--------------|------------------|
| FU* | 2025 | A | | * | * | * |
| GU* | 2025 | A | | * | * | * |

Chassis numbers

| Manufacturer | Filler | Type | Filler | MY | Factory | From | To | Prod from | Prod to |
|--------------|--------|------|--------|----|---------|--------|--------|-----------|---------|
| * | * | * | * | * | * | 000001 | 999999 | | |

Documents

| Document name |
|----------------------------|
| master.xml |

Condition

| REVISION HISTORY | | |
|------------------|------------|--|
| Revision | Date | Purpose |
| 3 | - | Revised <i>Service</i> (Added note on aux. equipment) |
| 2 | 08/19/2025 | Revised <i>Warranty</i> (Corrected TSB reference number) Revised <i>Additional Information</i> (Corrected TSB reference number) |
| 1 | 08/18/2025 | Initial publication |

Customer States:

- The gearbox warning lamp lights up in the cluster.

and/or

- There is no customer complaint; the DTC specified in workshop findings is found in the automatic transmission control unit J217 in connection with a different complaint.

Workshop Findings:

The following DTC (static/intermittent) is logged in the transmission control unit, J217 (address word 0002):

- **P060A00** – Control module internal processor monitoring malfunction (symptom 20899).

and/or

The following DTC (static/intermittent) is logged in the main control unit for drive and suspension, J1312 (address word 812C):

- **P1FD700** – Transmission control module warning light request active (symptom 385025).

Technical Background

Not applicable.

Production Solution

Not applicable.

Service



Please remove all electronic auxiliary equipment (e.g. electronic tachograph at OBD connector) from the vehicle. This equipment could have an effect on the vehicle electronics and trigger this complaint.

Please postpone the repair as there is currently no effective repair for the complaint described by the customer.

- Please erase the event memory entry in the transmission control unit.
1. Explain to the customer that a solution is expected to be available by the end of the 4th quarter of 2025 (subject to change) and that no repairs are necessary at this point.
 2. Do not replace any components for this condition since this will not resolve the customer's concern.
 3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*).

Warranty

| | | | |
|--------------------------|---|-----------|--|
| Claim Type: | <ul style="list-style-type: none"> • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. | | |
| Service Number: | 3730 | | |
| Damage Code: | 0039 | | |
| Labor Operations: | GFF / Guided Functions | 0150 0010 | See SRT with associated operations |
| | GFF / Guided Functions | 0150 0060 | Time stated on the diagnostic protocol |
| Claim Comment: | As per TSB 2079003/3 | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The target date communicated here is based on planning and is not binding. During the validation and regulatory approval of measures, there may be delays or hindrances in providing the measure throughout the entire process. This must be taken into account accordingly when communicating with customers.

All part and service references provided in this TSB (**2079003**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.