

Shock Symbol with "Do Not Drive Over 50MPH" Instrument Cluster Notification - U013281 and C156F00 in A108/X Active Roll Stabilization Control Units

Topic number	LI32.35-P-079752
Version	1
Function group	32.35 - Stabilizer
Date	9/9/25
Validity	167 (GLE and GLS), 223, and 294 with Option Code 465 AMG ONLY
Reason for change	

Complaint

Shock symbol in instrument cluster with "Do Not Drive Over 50MPH" message

AND

DTC's in A108/2 or A108/3:

U013281 - Communication with control unit "Suspension" has a malfunction. Incorrect data were received.

C156F00 - The signal values of the level sensors are implausible.

Cause

Physical layer wiring to the level control sensors B22/X.

Remedy

Check A108/2 and A108/3 for freeze frame data section "ZF_error_handler". The text will provide a good place to start.

Example: "SPC_FEHLER_VehLvl_Stat_HP_AMG_AR2_SNA_VehLvl_RR_V2_AMG" indicates the Right Rear may have initiated the DTC. See attached picture for reference.

Use Hioki to measure wiring to all four level sensors.

Use above DTC freeze frame data to inspect specific wiring.

In some instances, level sensors may rectify concern although wiring to a different level sensor may be the cause.

If vehicle exhibits concern after all of the above is completed, please open a TIPS case to the Body, Chassis, Entertainment Inbox.

Attachments																																																																																																																																																
File	Description																																																																																																																																															
A108 U013281 Handler.png A108/3 - Active roll stabilization REAR (Roll control) -I- <table border="1"> <thead> <tr> <th>Model</th> <th>Part number</th> <th>Supplier</th> <th>Version</th> </tr> </thead> <tbody> <tr> <td>Hardware</td> <td>167 901 47 05</td> <td>ZF</td> <td>20/21 000</td> </tr> <tr> <td>Software</td> <td>167 902 19 11</td> <td>ZF</td> <td>20/42 001</td> </tr> <tr> <td>Software</td> <td>167 903 92 05</td> <td>ZF</td> <td>20/42 000</td> </tr> <tr> <td>Boot software</td> <td>167 904 87 00</td> <td>ZF</td> <td>19/22 000</td> </tr> </tbody> </table> <table border="1"> <thead> <tr> <th>Event</th> <th>Text</th> <th>Status</th> </tr> </thead> <tbody> <tr> <td>U013281</td> <td>Communication with control unit "Suspension" has a malfunction. Incorrect data were received.</td> <td>S</td> </tr> </tbody> </table> <table border="1"> <thead> <tr> <th>Name</th> <th>First occurrence</th> <th>Last occurrence</th> </tr> </thead> <tbody> <tr> <td>Berechneter_DC_Strom_aus_MotorControl</td> <td>-0.01A</td> <td>0.21A</td> </tr> <tr> <td>E2E_Fehlertyp</td> <td>0</td> <td>0</td> </tr> <tr> <td>EPU_Controller_State</td> <td>7</td> <td>7</td> </tr> <tr> <td>Istpositions_Actuator</td> <td>-1.20°</td> <td>0.59°</td> </tr> <tr> <td>Klemme_15_Status</td> <td>4</td> <td>4</td> </tr> <tr> <td>Motor_rpm</td> <td>0.00RPM</td> <td>-190.00RPM</td> </tr> <tr> <td>Spannungsmessung_48V_Versorgung</td> <td>46.54V</td> <td>45.83V</td> </tr> <tr> <td>Stabilization_desired_torque</td> <td>0.00NM</td> <td>-58.00NM</td> </tr> <tr> <td>System_State</td> <td>NORMAL_MODE</td> <td>NORMAL_MODE</td> </tr> <tr> <td>VehLateralAccel</td> <td>-0.28m/s²</td> <td>0.30m/s²</td> </tr> <tr> <td>Vehicle_Speed</td> <td>0.00km/h</td> <td>78.00km/h</td> </tr> <tr> <td>ZF_error_handler</td> <td>SPC_FEHLER_VehLWl Stat_HP_AMG_AR2 SNA_VehLwL_RR_V2 AMG</td> <td>SPC_FEHLER_VehLWl Stat_HP_AMG_AR2 SNA_VehLwL_RR_V2 AMG</td> </tr> <tr> <td>_reserved_Klemme_15_Zaehler</td> <td>0</td> <td>0</td> </tr> <tr> <td>aktuell_Phasenstrom_Phase_1</td> <td>0.05A</td> <td>-0.21A</td> </tr> <tr> <td>aktuell_Phasenstrom_Phase_2</td> <td>-0.21A</td> <td>2.86A</td> </tr> <tr> <td>aktuell_Phasenstrom_Phase_3</td> <td>0.15A</td> <td>-2.46A</td> </tr> <tr> <td>gemessene_Temperatur_Controlboard</td> <td>47.79°C</td> <td>43.90°C</td> </tr> <tr> <td>gemessene_Temperatur_Powerboard</td> <td>31.10°C</td> <td>29.00°C</td> </tr> <tr> <td>Frequency counter</td> <td>--</td> <td>2.00</td> </tr> <tr> <td>Total distance</td> <td>16064.00km</td> <td>16160.00km</td> </tr> <tr> <td>Number of ignition cycles since the last occurrence of the fault</td> <td>--</td> <td>19.00</td> </tr> <tr> <td>Operating time</td> <td>--</td> <td>4294967295</td> </tr> </tbody> </table> <table border="1"> <thead> <tr> <th>Name</th> <th>First occurrence</th> <th>Last occurrence</th> </tr> </thead> <tbody> <tr> <td>Berechneter_DC_Strom_aus_MotorControl</td> <td>-0.01A</td> <td>0.17A</td> </tr> <tr> <td>E2E_Fehlertyp</td> <td>0</td> <td>0</td> </tr> <tr> <td>EPU_Controller_State</td> <td>7</td> <td>7</td> </tr> <tr> <td>Istpositions_Actuator</td> <td>-1.20°</td> <td>0.59°</td> </tr> <tr> <td>Klemme_15_Status</td> <td>4</td> <td>4</td> </tr> <tr> <td>Motor_rpm</td> <td>0.00RPM</td> <td>-194.00RPM</td> </tr> <tr> <td>Spannungsmessung_48V_Versorgung</td> <td>46.54V</td> <td>45.80V</td> </tr> <tr> <td>Stabilization_desired_torque</td> <td>0.00NM</td> <td>-51.00NM</td> </tr> <tr> <td>System_State</td> <td>NORMAL_MODE</td> <td>NORMAL_MODE</td> </tr> <tr> <td>VehLateralAccel</td> <td>-0.28m/s²</td> <td>0.30m/s²</td> </tr> <tr> <td>Vehicle_Speed</td> <td>0.00km/h</td> <td>78.00km/h</td> </tr> <tr> <td>ZF_error_handler</td> <td>HEIGHT_LEVEL_ERR OR</td> <td>HEIGHT_LEVEL_ERR OR</td> </tr> <tr> <td>_reserved_Klemme_15_Zaehler</td> <td>0</td> <td>0</td> </tr> </tbody> </table> <table border="1"> <tbody> <tr> <td>01.10.2024 08:25:32</td> <td>06/2024</td> <td>4JGF08KB4PAB81409 (167_389)</td> </tr> <tr> <td>Copyright 2024 Mercedes-Benz AG</td> <td>Order number: 6143421</td> <td>Page '11' of '19'</td> </tr> </tbody> </table>	Model	Part number	Supplier	Version	Hardware	167 901 47 05	ZF	20/21 000	Software	167 902 19 11	ZF	20/42 001	Software	167 903 92 05	ZF	20/42 000	Boot software	167 904 87 00	ZF	19/22 000	Event	Text	Status	U013281	Communication with control unit "Suspension" has a malfunction. Incorrect data were received.	S	Name	First occurrence	Last occurrence	Berechneter_DC_Strom_aus_MotorControl	-0.01A	0.21A	E2E_Fehlertyp	0	0	EPU_Controller_State	7	7	Istpositions_Actuator	-1.20°	0.59°	Klemme_15_Status	4	4	Motor_rpm	0.00RPM	-190.00RPM	Spannungsmessung_48V_Versorgung	46.54V	45.83V	Stabilization_desired_torque	0.00NM	-58.00NM	System_State	NORMAL_MODE	NORMAL_MODE	VehLateralAccel	-0.28m/s²	0.30m/s²	Vehicle_Speed	0.00km/h	78.00km/h	ZF_error_handler	SPC_FEHLER_VehLWl Stat_HP_AMG_AR2 SNA_VehLwL_RR_V2 AMG	SPC_FEHLER_VehLWl Stat_HP_AMG_AR2 SNA_VehLwL_RR_V2 AMG	_reserved_Klemme_15_Zaehler	0	0	aktuell_Phasenstrom_Phase_1	0.05A	-0.21A	aktuell_Phasenstrom_Phase_2	-0.21A	2.86A	aktuell_Phasenstrom_Phase_3	0.15A	-2.46A	gemessene_Temperatur_Controlboard	47.79°C	43.90°C	gemessene_Temperatur_Powerboard	31.10°C	29.00°C	Frequency counter	--	2.00	Total distance	16064.00km	16160.00km	Number of ignition cycles since the last occurrence of the fault	--	19.00	Operating time	--	4294967295	Name	First occurrence	Last occurrence	Berechneter_DC_Strom_aus_MotorControl	-0.01A	0.17A	E2E_Fehlertyp	0	0	EPU_Controller_State	7	7	Istpositions_Actuator	-1.20°	0.59°	Klemme_15_Status	4	4	Motor_rpm	0.00RPM	-194.00RPM	Spannungsmessung_48V_Versorgung	46.54V	45.80V	Stabilization_desired_torque	0.00NM	-51.00NM	System_State	NORMAL_MODE	NORMAL_MODE	VehLateralAccel	-0.28m/s²	0.30m/s²	Vehicle_Speed	0.00km/h	78.00km/h	ZF_error_handler	HEIGHT_LEVEL_ERR OR	HEIGHT_LEVEL_ERR OR	_reserved_Klemme_15_Zaehler	0	0	01.10.2024 08:25:32	06/2024	4JGF08KB4PAB81409 (167_389)	Copyright 2024 Mercedes-Benz AG	Order number: 6143421	Page '11' of '19'	ZF Error Handler Text
Model	Part number	Supplier	Version																																																																																																																																													
Hardware	167 901 47 05	ZF	20/21 000																																																																																																																																													
Software	167 902 19 11	ZF	20/42 001																																																																																																																																													
Software	167 903 92 05	ZF	20/42 000																																																																																																																																													
Boot software	167 904 87 00	ZF	19/22 000																																																																																																																																													
Event	Text	Status																																																																																																																																														
U013281	Communication with control unit "Suspension" has a malfunction. Incorrect data were received.	S																																																																																																																																														
Name	First occurrence	Last occurrence																																																																																																																																														
Berechneter_DC_Strom_aus_MotorControl	-0.01A	0.21A																																																																																																																																														
E2E_Fehlertyp	0	0																																																																																																																																														
EPU_Controller_State	7	7																																																																																																																																														
Istpositions_Actuator	-1.20°	0.59°																																																																																																																																														
Klemme_15_Status	4	4																																																																																																																																														
Motor_rpm	0.00RPM	-190.00RPM																																																																																																																																														
Spannungsmessung_48V_Versorgung	46.54V	45.83V																																																																																																																																														
Stabilization_desired_torque	0.00NM	-58.00NM																																																																																																																																														
System_State	NORMAL_MODE	NORMAL_MODE																																																																																																																																														
VehLateralAccel	-0.28m/s²	0.30m/s²																																																																																																																																														
Vehicle_Speed	0.00km/h	78.00km/h																																																																																																																																														
ZF_error_handler	SPC_FEHLER_VehLWl Stat_HP_AMG_AR2 SNA_VehLwL_RR_V2 AMG	SPC_FEHLER_VehLWl Stat_HP_AMG_AR2 SNA_VehLwL_RR_V2 AMG																																																																																																																																														
_reserved_Klemme_15_Zaehler	0	0																																																																																																																																														
aktuell_Phasenstrom_Phase_1	0.05A	-0.21A																																																																																																																																														
aktuell_Phasenstrom_Phase_2	-0.21A	2.86A																																																																																																																																														
aktuell_Phasenstrom_Phase_3	0.15A	-2.46A																																																																																																																																														
gemessene_Temperatur_Controlboard	47.79°C	43.90°C																																																																																																																																														
gemessene_Temperatur_Powerboard	31.10°C	29.00°C																																																																																																																																														
Frequency counter	--	2.00																																																																																																																																														
Total distance	16064.00km	16160.00km																																																																																																																																														
Number of ignition cycles since the last occurrence of the fault	--	19.00																																																																																																																																														
Operating time	--	4294967295																																																																																																																																														
Name	First occurrence	Last occurrence																																																																																																																																														
Berechneter_DC_Strom_aus_MotorControl	-0.01A	0.17A																																																																																																																																														
E2E_Fehlertyp	0	0																																																																																																																																														
EPU_Controller_State	7	7																																																																																																																																														
Istpositions_Actuator	-1.20°	0.59°																																																																																																																																														
Klemme_15_Status	4	4																																																																																																																																														
Motor_rpm	0.00RPM	-194.00RPM																																																																																																																																														
Spannungsmessung_48V_Versorgung	46.54V	45.80V																																																																																																																																														
Stabilization_desired_torque	0.00NM	-51.00NM																																																																																																																																														
System_State	NORMAL_MODE	NORMAL_MODE																																																																																																																																														
VehLateralAccel	-0.28m/s²	0.30m/s²																																																																																																																																														
Vehicle_Speed	0.00km/h	78.00km/h																																																																																																																																														
ZF_error_handler	HEIGHT_LEVEL_ERR OR	HEIGHT_LEVEL_ERR OR																																																																																																																																														
_reserved_Klemme_15_Zaehler	0	0																																																																																																																																														
01.10.2024 08:25:32	06/2024	4JGF08KB4PAB81409 (167_389)																																																																																																																																														
Copyright 2024 Mercedes-Benz AG	Order number: 6143421	Page '11' of '19'																																																																																																																																														

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms	
Chassis/suspension > Suspension/Dampening > Suspension System Function > Indicator lamp is on	
Chassis/suspension > Suspension/Dampening > AIRMATIC > Indicator lamp > lit	
Chassis/suspension > Suspension/Dampening > Electronic level control ENR > Malfunction	
Chassis/suspension > Suspension/Dampening > Roll control > Malfunction	
Control unit/fault code	
Control unit	Fault text
A108/3 - Active roll stabilization REAR (Roll control) (EARS167_R)	C156F00 - The signal values of the level sensors are implausible. _

XENTRY Tips

	U013281 - Communication with control unit "Suspension" has a malfunction. Incorrect data were received.
A108/2 - Active roll stabilization FRONT (Roll control) (EARS167_F)	C156F00 - The signal values of the level sensors are implausible. _ U013281 - Communication with control unit "Suspension" has a malfunction. Incorrect data were received.

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
---------	----------------	------	-------------	------