



SSM 54202 2023-2025 Explorer/Bronco Sport/Escape/Maverick - Inoperative Passenger Front And/Or Rear Window Switch

Some 2023-2025 Explorer (rear windows only), Bronco Sport, Escape, and Maverick vehicles equipped with minor feature code B2DAC may exhibit an inoperative passenger front and/or rear window switch. To confirm a vehicle is built with a certain minor feature code, review the build information by clicking "Additional Information" under Vehicle Information or double-clicking the vehicle identification number (VIN) in the upper left corner of Professional Technician System (PTS). This may be due to an open diode in one of the passenger window switches. To correct the condition, replace the passenger window switch of the affected window. If the condition persists continue with normal diagnostics. Refer to Workshop Manual, Section 501-11. For claiming, use causal part 14529 and labor operation 14529A in the Service Labor Time Standards (SLTS) Manual.