



## **SSM 54231 2023 Corsair - Head Up Display (HUD) - Missing Turn Signal Indicators, Turn-By-Turn Navigation, And/Or Gear Select Indication**

Some 2023 Lincoln Corsair vehicles equipped with a HUD may exhibit missing turn signal indicators, turn-by-turn navigation, and/or gear select indication in the HUD. The turn signal operation in the instrument panel cluster (IPC) and exterior of the vehicle is not affected. This may be due to configuration data in the HUD. To correct this condition, download and run the "HUD - Head Up Display (HUD) Module Configuration" application in the Ford Diagnosis and Repair System (FDRS) scan tool. For claiming use causal part 19G468 and labor operations 12651D and 12651D4. Advise customers that profile changes occur during this procedure and memory seat, mirror, and other preset selections will need to be reset.