



Service Bulletin

Bulletin No.: PIP6086

Date: September, 2025

PRELIMINARY INFORMATION

Subject: 8L45/90 No Movement After Valve Body Replacement

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	ATS	2016-2019		All	All	All	M5N M5T M5U
Cadillac	CT6	2016-2018		All	All	All	M5N M5X
Cadillac	CTS	2016-2019		All	All	All	M5N M5U
Chevrolet	Camaro	2016-2019		All	All	All	M5T M5U
Chevrolet	Colorado	2017-2019		All	All	All	M5T
Chevrolet	Corvette	2015-2019		All	All	All	M5U
Chevrolet	Express	2017-2019		All	All	All	M5U
Chevrolet	Silverado 1500	2015-2018		All	All	All	M5U M5X
Chevrolet	Silverado 1500 New Model	2019		All	All	All	MQE
GMC	Canyon	2017-2019		All	All	All	M5T
GMC	Savana	2017-2019		All	All	All	M5U
GMC	Sierra 1500	2015-2018		All	All	All	M5U M5X
GMC	Sierra 1500 New Model	2019		All	All	All	MQE
GMC	Yukon Denali	2015-2017		All	All	All	M5U

Involved Region or Country	North America
Condition	No Movement After Valve Body Replacement
Cause	Missing Gasket on Transmission Oil Pump

Correction

It has been found in some cases following a valve body replacement the transmission may exhibit a no movement concern.

This may be caused by a missing pump gasket on certain remanufactured valve bodies.

If there is no movement following the valve body replacement Do NOT replace the transmission but perform the following inspection.


Remove the newly installed valve body from the vehicle following appropriate SI procedures.

Once the valve body has been removed, remove the pump from the valve body and inspect for a missing gasket on the pump rotor.

If a missing pump rotor gasket is found please take a picture of the PUN number off the bag or valve body, start a TAC Case and upload the pictures order a pump seal kit and install the missing gasket and re-evaluate.


Please refer to the following pictures for reference.

Pump Rotor Gasket Missing

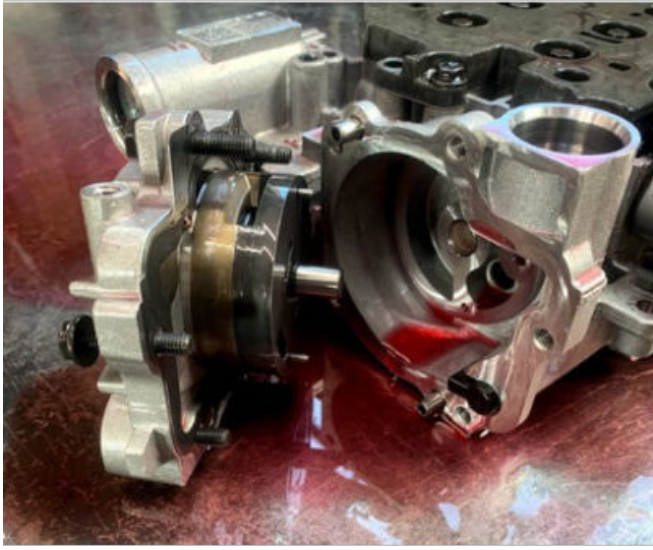

7000789

Pump Rotor Gasket Present

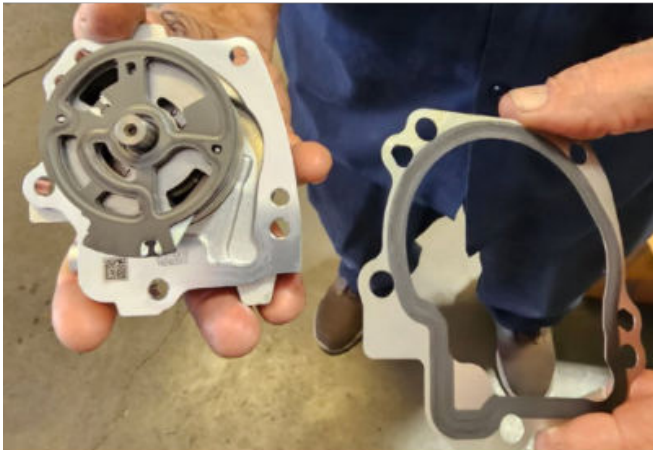

7000790

Parts Information

Description	Part Number	Qty
24066210	Pump Gasket Kit	1

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*8481238	Remove transmission pump assembly and replace pump and seals.	3.2 HRS
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	09/15/2025 - Created on.

