



Service Bulletin

Bulletin No.: PIT6145A

Date: September, 2025

PRELIMINARY INFORMATION

Subject: ABS Activation On Turns / Service Stability Message in DIC

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 4500HD	2019 - 2025		All	All	All	All
Chevrolet	Silverado 5500HD	2019 - 2025		All	All	All	All
Chevrolet	Silverado 6500HD	2019 - 2025		All	All	All	All

Involved Region or Country	North America
Condition	A customer may comment that the ABS activates when turning or that the Service Stability message is displayed in the DIC after the vehicle has been upfitted.
Cause	The vehicle frame may have been modified (lengthened or shortened) as a result of the vehicle upfit.

Correction

Dealer will need to measure the wheelbase of the vehicle to verify it is the same length as built from factory. If not, dealer will need to refer to the latest version of GM Upfitter Integration Bulletin 185 to ensure the EBCM has been reprogrammed with the correct calibrations for the modified frame length.

The information can be found at <http://www.gmupfitter.com/> under the "Technical Bulletin" Tab and then "Show all bulletins."

Version	2
Modified	03/28/2024 - Created on. 09/15/2025 - Updated Model Year

