


September 2023 production of 2024 model year to June 2025.



Please inspect the wood support under the slide out on the interior of the unit. If the wood support is wet/warped or not installed high enough, it could cause the drip cups to angle downward and allow water to drain inside the unit.

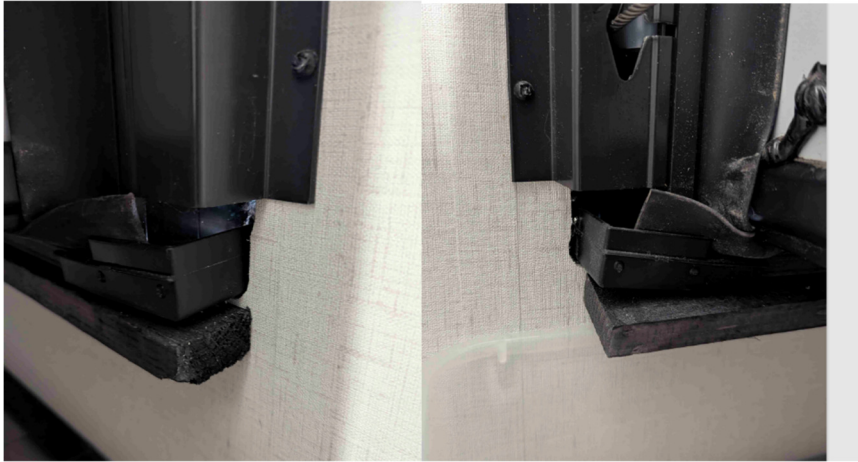

Recommend removing the 1x2 piece of wood painted black under the pan and replacing it with the metal bracket we currently use, reinstalling it slightly higher to ensure proper water drainage. Additionally, while the wood is removed, inspect the cups and ensure the premask putty tape is properly secured. The cups should be firmly attached to the pan, and if not, you should be able to seal those.