

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 687 GranTurismo – ICS Software Update



IMPORTANT NOTICE This bulletin supersedes MAS003889 MCL 23-76 released on Nov 30, 2023. It contains updated information, please ensure all previous versions are discarded.

DATE: September 25 2025

Certain Maserati GranTurismo (M189) MY24 listed in MODISCS+ are involved in a Rapid Update to update the Integrated Center Stack (ICS) software.

This software update improves the sensitivity of the touch screen. In rare instances, the ICS module may encounter sensitivity issues. It's crucial to emphasize that the overall functionality of the screen remains assured, and this concern specifically pertains to a less than optimal touch screen experience.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure

 All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **ICS** ► **ECU Programming** and follow the prompts.



Software version to be installed (or newer).

Market	SW Source	F188 Source	SW Target	F188 Target
ROW	7.1	670301413	7.2	673016522

ROW = Rest Of World

NOTE: if the ICS software installed on the vehicle is different from the source versions listed in the table, please open a BOL to request support

1. After ECU programming, perform **BCM – Procedures – PROXI Alignment**.
2. Procedure complete.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	687
Warranty Code	23
Error Code	063
Component Code	8.71.240
Operation Code	8.71.240.A (0,20 h)