



# VEHICLE - WARRANTY BULLETIN

SEPTEMBER 11, 2025

BULLETIN 2025-6 | VERSION A

CAMPAIGN N° 2025-0006

Can-Am On-Road

## CAUTION

All involved customers must be notified, all involved units must be corrected as per instruction herein.

## Pulse Rear Central Reflector Replacement

### IMPORTANT

#### When receiving a vehicle for service:

- Always lookup the vehicle identification number (VIN) on the Knowledge Center to check for pending campaigns or alerts.
- Always connect the vehicle to the BRP diagnostic software (BUDS) to ensure all required updates are performed.

### APPLICABILITY

MODEL YEAR	MODEL	ADMISSIBLE UNITS
MY25	Can-Am Pulse	Go to BOSSWeb/Warranty/Campaign Monitoring to know which units in your inventory are impacted by this campaign.

### PROBLEM

The rear reflector adhesion may not be optimal.

### SOLUTION

At PDI, replace the rear reflector and add a layer of 3M RP45 VHB™ double-sided tape (or equivalent).



## REQUIRED PARTS


Order the parts through the regular channel.

BRP recommends the usage of 3M RP45 VHB™ double-sided tape, 0.045-inch (1.1 mm) thick. The thickness is really important to ensure a quality repair. Order it through your preferred hardware supplier (Uline, DigiKey, automotive part store). A roll will do multiple units, the flat rate is adjusted to cover the cost of the tape for each unit

DESCRIPTION	PART NUMBER	QTY
Rear red reflector	705015551	705015551
3M RP45 VHB™ double-sided tape, or equivalent	-	60 mm (2 3/8 in)

## CORRECTIVE ACTION


1. Remove and discard the rear reflector from the vehicle.

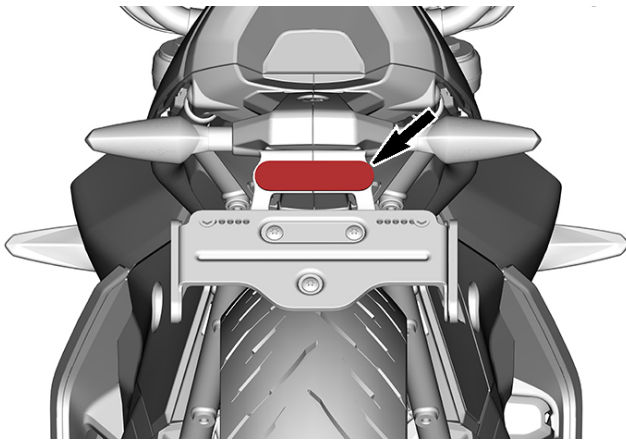

2. Clean the surface to eliminate all glue residues, dust and grease.
3. Cut a 60 mm (2 3/8 in) strip of 3M RP45 VHB™ tape.
4. Peel off the protective liner from the new reflector.
5. Peel off the protective liner only on one side of the 3M RP45 VHB™ tape.
6. Apply the 3M RP45 VHB™ tape centered on the adhesive of the new reflector.

### NOTE

3M recommends the usage of a roller to ensure good contact and to remove air bubbles.

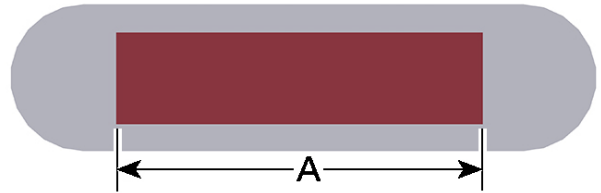

• A = 60 mm (2 3/8 in)

7. Peel off the protective liner on the other side of the 3M RP45 VHB™ tape.
8. Align and firmly install the new reflector. Follow the tape product application instructions to ensure a good bond. 3M recommends to apply a pressure of at least 1 kg/cm<sup>2</sup> (15 PSI) and wait minimum 24 hours before stressing the bond.

## WARRANTY

Submit a warranty claim using the following information.

For claiming procedure, refer to the online *Dealer/Distributor Warranty Guide*.

WITH BOSSWEB

CLAIM DETAILS	
Product Line	Motorcycle
Unit Model Year	2025
Campaign/Bulletin/Description	6 / 2025-6 / Rear Reflector
<b>*Action</b>	
<b>Inspect</b>	<b>Repair</b>
<input type="checkbox"/>	<input checked="" type="checkbox"/>
Total Labor Time Paid	0.2 hour



**CLAIM DETAILS**

Expiration Date	October 31, 2028
-----------------	------------------

WITH WARRANTY ON DEMAND

**CLAIM DETAILS**

Claim Type	Unit Campaign
Serial Number	Enter Serial Number
Warranty Campaign	Select <i>Rear Reflector / BULLETIN 2025-6 / 2WV-2025-0006</i> from the drop-down list
Date of Repair	Repair date
Total Labor Time Paid	0.2 hour
Expiration Date	October 31, 2028