

 Preview Solution CBR-2482-2

PTO Malfunction Pop Up - VN (4) - PR (4)

Published 5 September 2025

Valid For

Volvo Chassis - VN (4)

Mack Chassis - PR (4)

Model Year - 2025 to current

Purpose of this CBR is to address Pop up message for PTO Malfunction when there is no PTO Installed.



When encountering a unit with a pop-up message for PTO malfunction and fault code P100A15, follow steps below:

1. Check to see if unit has a PTO switch installed in dash. If there is a switch, check to see if there is a PTO solenoid installed on transmission.

2. If there is no solenoid installed on transmission please order parts below and install solenoid.

Part Number	QTY.	Description
2517341	2	Flange Screw M6x14
24036589	1	Connector, 1/4" Tube- Straight
23616853	1	Plug, Push in Plug - 1/4" Inch
23616844	2	Nipple, 1/4" - Small
24145125	1	Solenoid Valve 3/2 NC, 24V
1113569	1	Tube 6, 4 x 1
995627	1	Plug, Small
980464	1	Cable Tie

NOTE: If solenoid bracket is not installed please order: 24262391

NOTE: P/N 1113569 is only available for order in 100 ft rolls.

3. Once solenoid is installed, please clear faults and release unit to service.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article