



Subject: FORWARD SENSING CAMERA (FSC) WARNING MESSAGES	Service Alert No.: SA-043/25
	Last Issued : 09/29/2025

BULLETIN NOTES

This service alert supersedes the previously issued service alert listed below. The changes are noted in Red text.

Previous Service Alert	Date(s) Issued	Previous Service Alert	Date(s) Issued
SA-066/22	10/12/22	SA-003/19	07/30/19 and 01/14/19
SA-036/21	05/18/21	SA-023/18	05/01/18
SA-037/20	03/03/20	SA-066/17	09/01/17

APPLICABLE MODEL(S)/VINS

Gen 6	Gen 7
2014-2018 Mazda3	2019- 2026 Mazda3
2014-2021 Mazda6	2020-2026 CX-30
2016-2021 CX-3	2022-2023 MX-30
2016-2025 CX-5	2023-2026 CX-50 (All)
2016-2023 CX-9	2025-2026 CX-70 (All)
2016-2026 MX-5	2024-2026 CX-90 (All)

DESCRIPTION

Some vehicles may have one of the following DTCs stored in memory along with a system status notice on the Multi-information display OR display a system status notice with no DTC:

- C1001:92 - Forward sensing camera (FSC) poor field of view [Gen 6 vehicles]
- B14F0:92 - General temporary failure in forward sensing camera (FSC) [Gen 7 vehicles built on or before March 2, 2019]
- No DTC - Warning Message only [Gen 7 vehicles built after March 2, 2019]



DTC C1001:92 or B14F0:92 set as a past record for low visibility of the Forward Sensing Camera (FSC). It does not mean there is an actual FSC defect.



- In some cases the customer may have a concern with the Lane Departure Warning System (LDWS) and/or High Beam Control system (HBC).
- In other cases this DTC might be found without a related customer concern.

NOTE: In most cases, no dealer visit is necessary.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

The following Multi-information display system status notifications may be displayed:

Gen 6 Vehicles		
Warning Message		DTC
Front Camera Blocked. Windshield Defog Necessary	 Front Camera Blocked. Windshield Defog Necessary	C1001:92
Clean Exterior Windshield Completely	 Clean Exterior Windshield Completely	

Gen 7 Vehicles built on or before March 2, 2019		
Warning Message		DTC
Safety and Driver Support Systems Temporarily Disabled.	 Safety and Driver Support Systems Temporarily Disabled.	B14F0:92
Low Camera Visibility. Drive Safely	 Low Camera Visibility. Drive Safely	

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Gen 7 Vehicles built after March 2, 2019


Warning Message

No DTC


Safety and Driver Support Systems Temporarily Disabled.



Reason for warning message can be viewed using MDARS.
Go to Toolbox -> Operational records -> i-
ACTIVSENSE -> Reading Operation records of FSC -
> **Run**

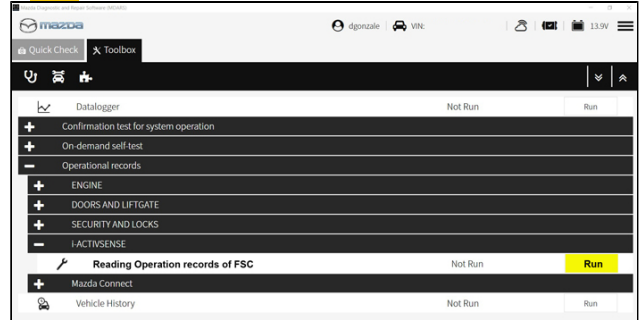


Select customer concern record.

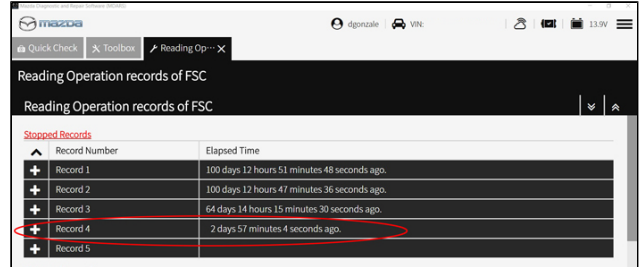

Low Camera Visibility.
Drive Safely



View reason for warning message

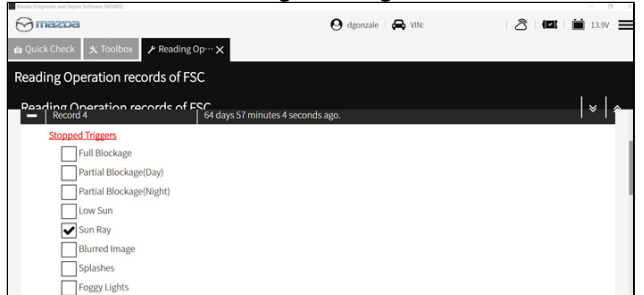

NOTE: Reading Operation records of FSC is available for all Gen 7 vehicles.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

NOTE: Instrument Cluster and Multi-Information Display warning messages vary depending on vehicle year/model, as well as Type A or Type B Instrument Clusters. Refer to MULTI-INFORMATION DISPLAY in Service Highlights for more information.

- If the vehicle has DTC, DO NOT replace the FSC. Read below.
- If the Gen 7 vehicle (built after March 2, 2019) has warning message and no DTC, DO NOT replace the FSC. Read below.
 - Use MDARS Reading Operation records of FSC to view reason for triggering warning message.

The vehicle may or may not store DTC C1001:92 or B14F0:92 and stop the FSC function while driving under the following conditions:

1. At night, when there is NO artificial lighting such as a traffic signal, street light or reflective surfaces.
2. When direct or reflected sunlight makes forward visibility difficult (Backlight).
3. When it's hard to see the traffic lane due to a wet or snow covered road reflecting lights.
4. When visibility is poor in front of the vehicle due to fog.
5. When driving on a road without markings.
6. In conditions where the windshield fogs easily.

If the customer has concerns regarding the LDWS and/or HBC malfunction, confirm when the issue first happened. If the issue happened during one of the driving conditions above, explain the following 2 items to the customer.

- The FSC stops the LDWS and/or HBC functions temporarily when the FSC can't recognize the traffic lane or decides the front view is obstructed.
- This is not a failure of the FSC, the system is disabled to avoid unintended operation.

NOTE: In the case of HBC, make sure the customer is using the system correctly and is aware of when it will and will not turn on the high beams.

The HBC system switches to low beam when:

- You are approaching a vehicle or a vehicle is approaching in the opposite direction.
- Driving on roads lined with street lights or well-lit cities and towns.
- At speeds lower than 12 mph (20 km/h).

Examples of driving under adverse conditions:

The front windshield or the FSC lens is foggy.



Low visibility by rain, fog or snow



Page 4 of 6

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

At night with no traffic light



Direct or reflected sunlight on the FSC



Water splashing



Heavy snow



Strong halo



Backlight from tunnel exit



CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Reference: MGSS --> Service Highlights --> MULTI-INFORMATION DISPLAY

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.