

## Technical Service Bulletin

<b>Topic</b>	94 Warning lamp for exterior lighting displayed in instrument cluster: DTC U112100, U110B00, B126A29
<b>Market area</b>	United States 444 Volkswagen of America, Inc. (6444)
<b>Brand</b>	Audi
<b>Transaction No.</b>	2074786/2
<b>Level</b>	EH
<b>Status</b>	Released for publishing
<b>Release date</b>	Sep 26, 2025

### Diagnostic trouble codes

Diagnostic address	Diagnostic trouble code	Fault symptom	Storage state
0009 - Electronic central electric	B126A29: Light switch implausible signal		static
0009 - Electronic central electric	U112100: Data bus missing message		static
0009 - Electronic central electric	U110B00: Light switch no communication		static

### New customer code

Object of complaint	Complaint type	Position
information, navigation, communication, entertainment -> malfunction display symbols -> adaptive headlamp/cornering lamp malfunction display	functionality -> activates	
information, navigation, communication, entertainment -> malfunction display symbols -> exterior lighting malfunction indicator	functionality -> activates without cause	
information, navigation, communication, entertainment -> malfunction display symbols -> exterior lighting malfunction indicator	functionality -> activates	
information, navigation, communication, entertainment -> malfunction display symbols -> adaptive headlamp/cornering lamp malfunction display	functionality -> activates without cause	

## Vehicle data

### A3, Q4

#### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
8Y*	2022	A		*	*	*
8Y*	2023	A		*	*	*
8Y*	2024	A		*	*	*
F4*	2022	A		*	*	*
F4*	2023	A		*	*	*
F4*	2024	A		*	*	*

# Documents

Document name
---------------

master.xml
------------

**Technical Service Bulletin**

Transaction No.: **2074786/2**

94 Warning lamp for exterior lighting displayed in instrument cluster: DTC U112100, U110B00, B126A29

Release date: Sep 26, 2025

**Condition**

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Condition</i> (Updated DTC verbiage) Revised <i>Production solution</i> (Updated sw and part number index)
1	08/01/2024	Initial publication

**Customer statement:**

A warning lamp for the exterior lighting or adaptive light is displayed in the instrument cluster. The lighting system appears to be working as it should.

This phenomenon occurs only very occasionally.

Pressing the “AUTO” button on the light switch module remedies the fault immediately and causes the warning lamp to go out.

**Workshop findings:**

The concern can be reproduced. The following DTCs are stored in the onboard supply control unit J519 (address 0009):

- **DTC B126A29** Light switch implausible signal
- **DTC U112100** Data bus missing message.
- **DTC U110B00** Light switch no communication.

All lighting functions are working.

**Technical Background**

Diagnostic software too sensitive in the J519.

**Production Solution**

Optimized software 0013 with part index AC,AD for the J519.

**Service**

This TSB Closes PSS 20373612: *94 PSS Headlight warning in cluster, DTC : B126A29, U110B00 stored in 09 module.*

Check whether the situation is as described above.

Pressing the “AUTO” button will cause the warning lamp to go out and the DTC entry to change to intermittent.

The DTC can then be deleted.



If only DTC “U110B00 Light switch no communication” is stored without the other entries, the cause may be a loose connector, a pin that has been pushed back or a wiring problem.

When billing, attach a photo that clearly shows the complaint to DOC-IT.

## Warranty

<b>Claim Type:</b>	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
<b>Service Number:</b>	9405		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	Service light switch	9405 4199	Bill according to the time required
	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Labor according to the diagnostic log
<b>Claim Comment:</b>	As per TSB 2074786/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All parts and service references provided in this TSB (**2074786**) are subject to change and/or removal.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.