

Technical Service Bulletin

Topic	66 Loose trim strip
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Audi
Transaction No.	2079223/1
Level	EH
Status	Released for publishing
Release date	Sep 9, 2025

New customer code

Object of complaint	Complaint type	Position
body attachments and installations -> trim components, protective molding, decoration, dirt deflector -> C-pillar trim	component, automotive fluids -> loose	

Vehicle data

Audi Q6 e-tron

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
GFB*	2025	A		*	*	*

Documents

Document name
master.xml

Condition

Customer states:

- The ends of the rear left or right decorative trim are protruding.

Workshop findings:

- The C-pillar trim is not flush with the vehicle at the front or rear end. The clip has not engaged properly.
- This issue may affect the left or right side of the vehicle.

Technical Background

The clip on the component is too thin. It may be crushed during assembly and the trim strip will not fit properly to the body.

Production Solution

An optimized component has been in use since 24 July 2025.

Service

If the trim strip protrudes at the front or rear (see pictures), it must be renewed.



Figure 1. Example of the protruding trim.



Figure 2. Example of the protruding trim.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6633		
Damage Code:	0018		
Labor Operations:	Removing and installing upper side panel trim (left or right)	6634 1900	See SRT with associated operations
	Removing and installing upper side panel trim (left or right)	6634 1950	See SRT with associated operations
Claim Comment:	As per TSB 2079223/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2079223**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair

Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2025 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.