

## KA-01911 750S - Exterior Door Switch Inoperative

### Document Information

**Location:** Body Exterior – Door release

**Topic:** Door switch inoperative

**Condition:** Intermittent


**Diagnostic Trouble Codes:** N/A

### Measure

Through continuous product quality monitoring, McLaren have implemented a new door switch winglet component for McLaren 750S vehicles manufactured from 2025 onwards.

It has come to our attention that some 750S vehicles produced prior to this update may experience intermittent external door switch operation, under specific conditions. When exposed to high ambient temperature for extended periods, thermal expansion of the paddle material may prevent proper contact with the switch rendering it inoperative.

Please refer to the images below for comparison between the original and updated winglet components.

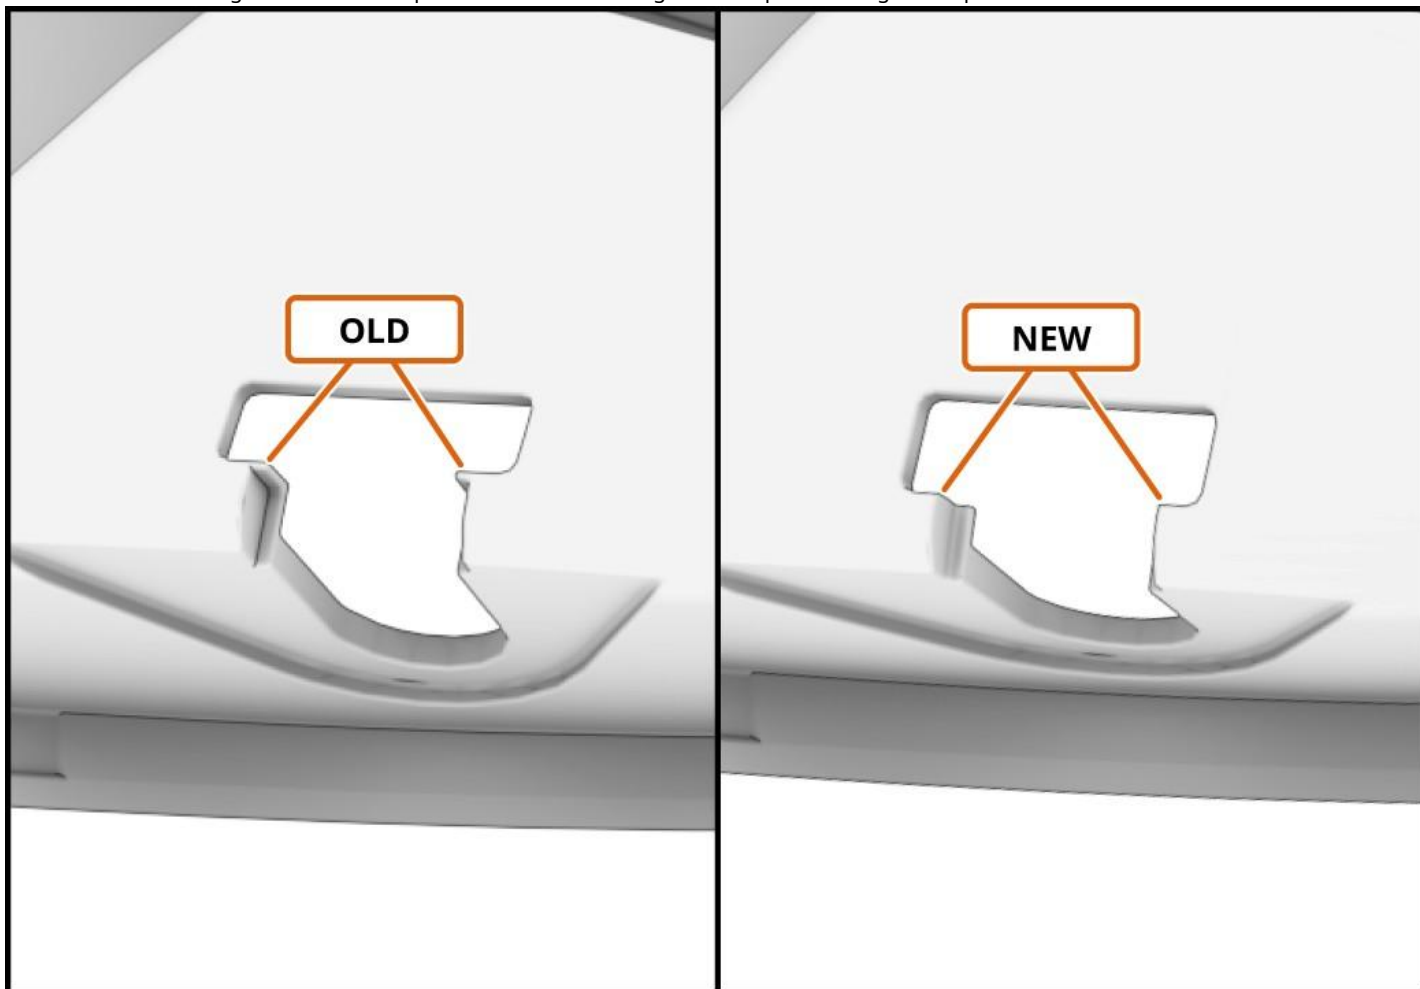

If you find this concern, please order replacement parts as per below parts information and reference MSP procedure – “Door Release Switch – External”.

### Parts Information

28AB557CP - WINGLET DOOR OUTER LH

28AB558CP - WINGLET DOOR OUTER RH

### Repair Time

Hours: 3.05 - Per side

### Attachments

N/A