

Campaign code:
L74X-A.22.25

Campaign name:
Hood puffer washer rust

Model:
Revuelto

Model Year:
2024-2025


Markets:
Australia, Austria, Azerbaijan, Bahrain, Belgium, Brazil, Cambodia, Canada, China, Czech Republic, Denmark, Estonia, France, Germany, Greece, Hong Kong, Hungary, India, Indonesia, Italy, Japan, Kuwait, Latvia, Lebanon, Luxembourg, Macao, Malaysia, Mexico, Monaco, Netherlands, New Zealand, Norway, Oman, Peru, Philippines, Poland, Portugal, Qatar, Romania, Saudi Arabia, Singapore, South Africa, South Korea, Spain, Sweden, Switzerland, Taiwan, Thailand, Turkey, United Arab Emirates, United Kingdom, United States, Vietnam

VIN Involved:
Until VIN 3325

Important information: before proceeding with the repair, connect to the Warranty Portal and, using the “VIN Info” function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.
- NOTE:** some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;
- only replacement parts that correspond to the specific operation, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

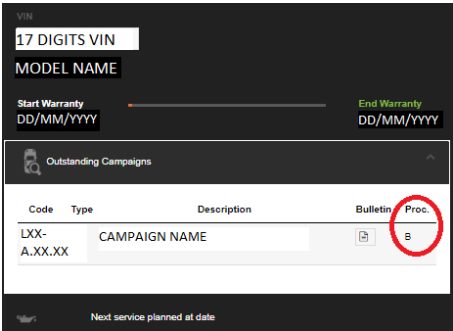

NOTE:
Operation A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

Information for the service network:
As part of the continuous monitoring of the product, Automobili Lamborghini S.p.A. requires the washers of the engine bonnet stoppers to be removed

Solution for the field:
The following instructions include one operation.

Spare Parts:

OPERATION B

Part number	Description	Q.ty
n\a	n\a	n\a

Management of replaced parts:
Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes so that they can be identified during visits by the competent Area Manager.

Labor time:
Operation B: 0.17 h

Previous bulletins superseded.
None.



Warranty claim instructions:

To request reimbursement for the repair performed, access the "LIASS" system on the Lamborghini portal and, following the instructions in the system's "Manuals" section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPERATION B:**
 - o *Steps to be executed: 1 to 8*
 - o *Labour time: 0.17 h*

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section "Service and Recall Campaigns":

Tools/Materials required

Code	Description.	Q.ty
n/a	n/a	n/a





NOTE:

All ODIS technical documentation can be viewed on the Lamborghini web portal, in the ODIS section.

OPERATION B Repair method:

Follow the instructions:

1. Open the rear bonnet (1).
2. Loosen the nut (2).
3. Unscrew the stopper (3) gauge by removing it completely.
4. Remove washer (4).
5. Re-tighten the stopper (3) until the nut (2) is flush.
6. Before tightening nut (2), ensure that there is a distance of approximately 15 mm between its base and the bottom of stopper (3). Then, tighten nut (2) with a torque of 3.3 Nm.
7. Carry out the operation on all four stoppers.
8. Once the procedure is complete, close the engine bonnet (1) and check that it is aligned correctly. If it is not aligned correctly, adjust the four stoppers (3) until it is.

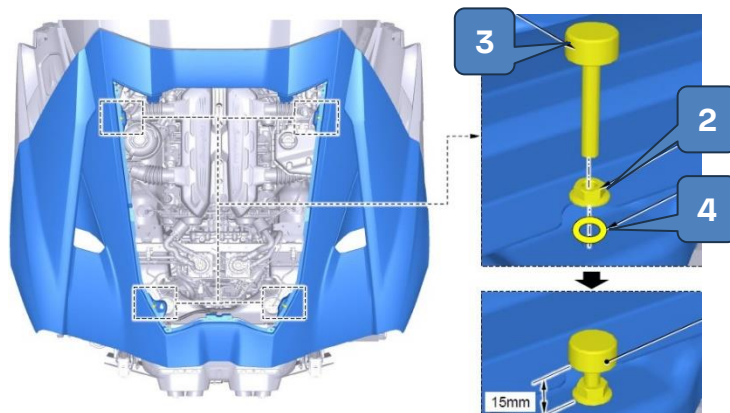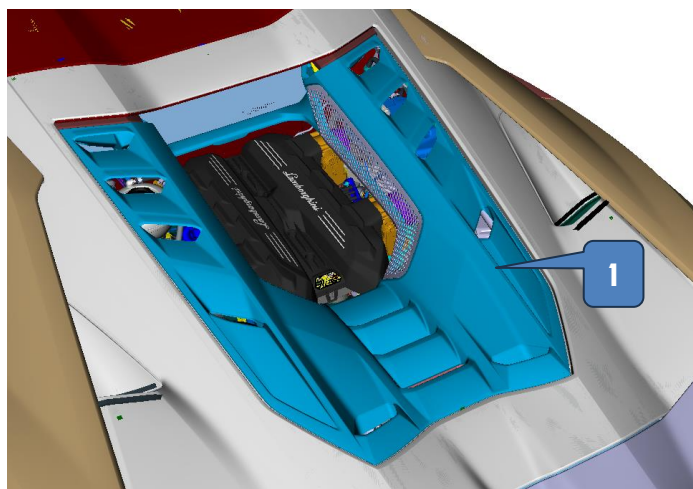

L74X-A. 22.25	To: After Sales Official Network Subject: Hood puffer washer rust Date: 15/09/2025 Pages 4	
--------------------------------	---	--



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol wirh BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or open a ticket to Technical Support in Lamborghini KEY (Request – General Information – After Sales Services - After Sales Technical Support).

Regards,
Lamborghini Service

Rev.00 CONFIDENTIAL	The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.	4/4 Doc. no.: L/V6_M06 Rev.[07]
----------------------------	---	--