



STAR ONLINE PUBLICATION



Case Number: S2523000080

Release Date: September 2025

Symptom/Vehicle Issue: Front Side Marker Lamp Diagnostic Trouble Code (DTC) Information.

Customer Complaint/Technician Observation: Customer may see a lamp outage warning. Tech finds one or more of the following DTCs:

B16BF-13 Front Left Side marker Lamp Control-Circuit Open
B16BF-19 Front Left Side marker Lamp Control-Overcurrent
B16C3-13 Front Right Side marker Lamp Control-Circuit Open
B16C3-19 Front Right Side marker Lamp Control-Overcurrent

Discussion: KM side marker lamps are located inside the headlamp assembly. The headlamp operations are controlled by the Smart Lamp Module (SLM). If the SLMR (right side) or SLML (left side) has one of the above DTCs set, check fog lamp on corresponding side for open circuit/function. If fog lamp is open, replace fog lamp, then recheck vehicle for side marker DTCs and function.

<<<**Note**>>> Engineering is investigating resolution to address this condition.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.