

WSJ1 - Replacing Lid for Closing Aid Motor (Workshop Campaign)

Model Line: **Macan (XAB)**

Model Year: **As of 2024 up to 2026**

Concerns: **Lid for closing aid motor**


Cause: **Electric closing aids for the rear lid were installed on the affected vehicles, on which the microswitch for determining the lid position was not installed correctly.**

Due to the faulty signal from the microswitch, the rear lid cannot be opened, closed or locked and the message "Doors open" is displayed on the instrument cluster.

Campaign: Replace lid for closing aid motor with an optimized type.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Installation Position:

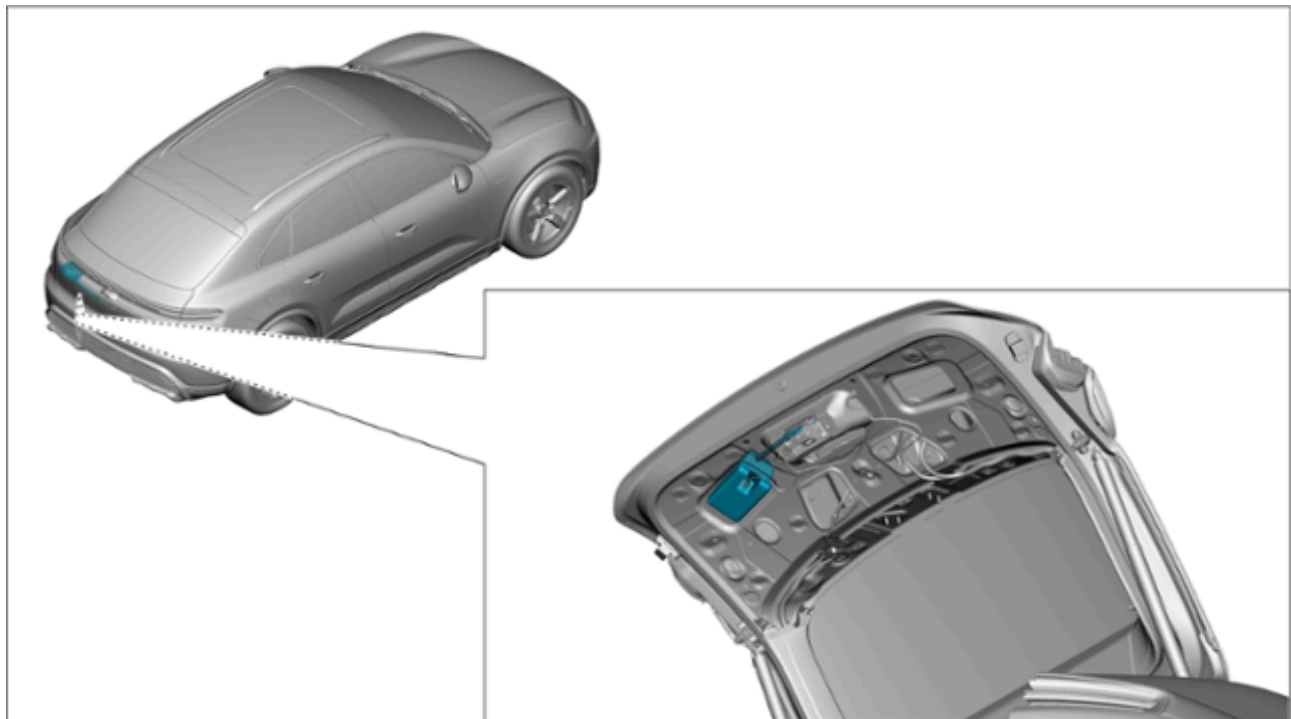

Installation position of lid for closing aid motor

Required parts

The **part numbers** of the **required parts** for the respective vehicle can be seen in the **scope**, see section "warranty processing".

Required Tools

Tools: ▪ Torque wrench, 6-50 Nm (4.5-37 ftlb.) e.g. **V.A.G 1331A - torque wrench, 6-50 Nm (4.5-37 ftlb.)**

Replace lid for closing aid motor

- Work Procedure: 1 Replace lid for closing aid motor.
For procedure, see: ⇒ *Workshop Manual '557419 Removing and installing lid for closing aid motor'*
- 2 Enter the campaign in the Warranty and Maintenance Logbook.

Warranty processing



Information

The specified labor time was determined specifically for carrying out this campaign and includes all necessary preliminary work and rework. The labor time can differ from the labor time published in the Labor Operation List in the PCSS.

Scope 1:

Replace lid for closing aid motor

Labor time:

Replace lid for closing aid motor

Labor time: **51 TU**

- Includes:
- Removing and installing upper part of rear lid lock
 - Removing and installing upper part of rear lid lock (cover)
 - Removing and installing trim panel for rear lid
 - Removing and installing rear lid lock release

Required parts:

VO4015800DN	Rear lid closing aid motor	1 piece
PAF912032	M8 x 22 countersunk screw with internal serration - Upper part of rear lid lock	2 piece(s)

⇒ **Damage Code WSJ1 066 000 2**

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2025 Porsche Cars North America, Inc.