

**Washer Fluid Leaking at Front Left Cover Hinge/Hose for Front Windshield Washer System Leaking: Observe the Specified Procedure (58/25)**

Model Line: **911 (991)**

Model Year: **As of 2012 up to 2019**

Concerns: **Windshield washer system hose**

Cause: **The customer complains about water leaking at the front left cover hinge, as well as no or insufficient function of the front windshield washer system.**

The leak can be narrowed down to a damaged hose for the front windshield washer system in the area of the cover hinge.

Action: If there is a customer complaint, replace the hose for the front windshield washer system.

**Required parts**

Parts Info:	Part No.	Designation – Location of use	Quantity
	99162866707	⇒ Washer fluid hose pipe – Windshield washer system connection point	1 piece
	95862822200	⇒ Connection piece – Windshield washer system hose	1 piece

**Required tools**

Tools:
 


- Setting tool, e.g. **9852 - Setting tool**

**Replacing the front windshield washer system hose**

- Work Procedure:
- 1 Remove the windshield washer system spray nozzles.  
⇒ *Workshop Manual '926619A1 Removing and installing the spray nozzle for the windscreen washer system'*
  - 2 Remove the technical equipment space cover.  
⇒ *Workshop Manual '852219A2 Removing and installing the technical equipment space cover'*

- 3 Replace the previous hose for the front windshield washer system with a **new** hose for the front windshield washer system ⇒ *Front windshield washer system hose routing -1-*.  
Connect an **additional** new connection piece ⇒ *Front windshield washer system hose routing -2-* to the new hose on the front windshield washer system ⇒ *Front windshield washer system hose routing -1-*.

Make sure that the hose is laid in the same way as the original hose installation. ⇒ *Front windshield washer system hose routing*

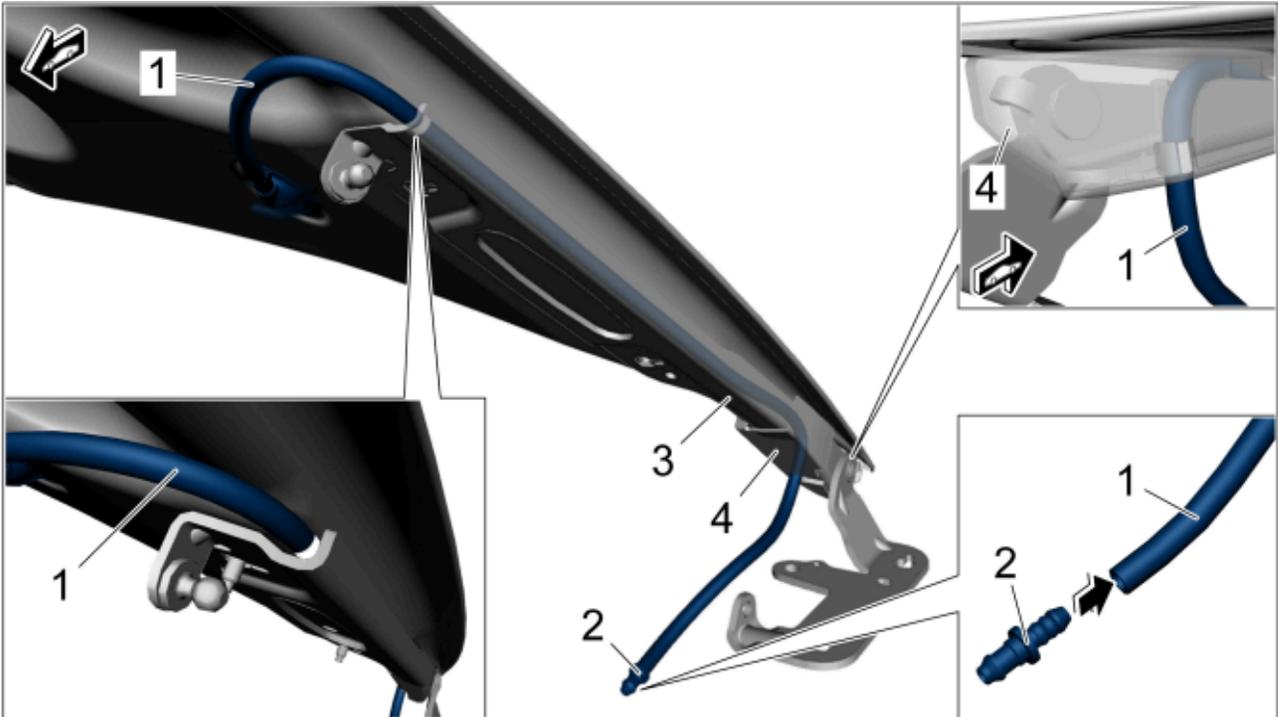

*Front windshield washer system hose routing*

- 1 – Front windshield washer system hose
- 2 – Connection piece
- 3 – Front left cover hinge
- 4 – Hose holder

- 4 Install the technical equipment space cover.  
⇒ *Workshop Manual '852219A2 Removing and installing the technical equipment space cover'*
- 5 Install the windshield washer system spray nozzles.  
⇒ *Workshop Manual '926619A1 Removing and installing the spray nozzle for the windscreen washer system'*

**Labor position and PCSS encryption**

Labor position:

<b>APOS</b>	<b>Labor operation</b>	<b>I No.</b>
92545540	Replacing the windshield washer system hose	
92545541	Replacing the windshield washer system hose (GT2 RS / GT3 RS only)	

PCSS encryption:

<b>Location (FES5)</b>	92540	Windshield washer system hose
<b>Damage type (SA4)</b>	1521	Crack/incipient crack

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2025 Porsche Cars North America, Inc.