



2024 Prologue Vehicle-Wide Programming #1

Replaces Job Aid: Vehicle Wide Programming, date June 14th 2025

APPLIES TO

Year	Model	Trim Level	VIN Range
2024	Prologue	ALL	ALL

Background or Symptom

Vehicle-Wide Programming (VWP), also known as SPS3-VWP, is a feature within Techline Connect (TLC) to update all applicable control module software at the same time. When initiated, all applicable updates are done in parallel, instead of the conventional individual control module update. Customers may have complaints or concerns that may get resolved by doing this software update.

NOTE: The A11 Radio Control Module and the K73 Telematics Control Module are excluded in the VWP feature and must be updated individually when necessary, using SPS2.

ENHANCEMENTS / RESOLVED ISSUES

Control Module		Enhancements or Resolved Issues
B174	Front View Camera - Windshield	<ul style="list-style-type: none"> Fixes issue where option for Traffic Sign Monitoring is shown in error. Improvements to Adaptive Cruise Control system.
B233B	Forward Range Radar Sensor – Long Range	<ul style="list-style-type: none"> Improves radar alignment and reduces false positives when using Adaptive Cruise Control.
B233	Short Range Radar Sensor	<ul style="list-style-type: none"> Detection improvements for Rear Automatic Emergency Braking, Rear Cross Traffic Alert and Cyclist Detection. Address DTCs U197A, U3000 78, U3000 9A, U3000 97, U1126, U3000 49.
K183	UHF Short Range Low Energy Remote Control Access Transceiver	<ul style="list-style-type: none"> Improves DTC U3000 detection. Fixes issue that causes DTC U018B.
K9	Body Control Module	<ul style="list-style-type: none"> Improves dome light control by adding the ability to turn on/off all interior lights. Addresses DTC U0140
K219	Lighting Control Module	<ul style="list-style-type: none"> Fixes inoperable welcome lights (Touring and Elite only).
K40D	Driver Seat Adjuster Memory Module	<ul style="list-style-type: none"> Fixes issue with seat memory not functioning on vehicle entry. Fixes unintended seat movement while driving.

K16	Battery Energy Control Module	<ul style="list-style-type: none"> Battery thermal control improved to prevent issues when charging with a Level 3 charger. Addresses Loss of Communication DTCs. Fixes Unable to Charge message shown on meter when charging using a Level 1 or 2 chargers.
K16A	Battery Energy Control Module 1	<ul style="list-style-type: none"> Improved heater/defrost performance at extreme cold temperatures. Previously addressed by Service Bulletin 25-026, Service High Voltage Message B2BAA.
K182	Parking Assist Control Module	<ul style="list-style-type: none"> Addresses DTC U3000 92.
K107	Driver Motor Control Module	<ul style="list-style-type: none"> Addresses DTC P061B.
K157	Video Processing Module	<ul style="list-style-type: none"> Addresses DTC U3000 49 and U1961 92. Fixes issue inoperable multi view camera.
K56	Serial Data Gateway Module	<ul style="list-style-type: none"> Improvements for the OTA system Addresses DTC U0447.
K160	Brake System Control Module	<ul style="list-style-type: none"> Fixes incorrect Traction Control System alert when wheel speed sensors are stuck. Fixes Service Brake Assist error with DTC C2A22. May be accompanied with a ticking sound from the brake pedal area.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0105C6	<ul style="list-style-type: none"> Launch VWP and scan for software updates. Perform the updates 	0.4	03265	03217	A25081A	24061062
0100B9	<ul style="list-style-type: none"> Launch VWP and scan for software updates. Updates NOT required. 	0.2	03265	03217	A25081B	24061062

REQUIRED SPECIAL TOOLS

Description
Multiple Diagnostic Interface 2 (MDI2)
Tech Line Connect (TLC) Software with Honda Diagnostic Package
DCA-8000 Dynamic Diagnostic Charging System
USB 3.1 (or higher) Type-C 32GB

UPDATE PROCEDURE

Do the Vehicle-Wide Programming outlined in the Job Aid: [Updating Control Unit Modules with TECHLINE CONNECT](#).