

MAS004768 RU 25-28

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 788 Grecale – USB Port Trim Check

TECHNICAL SERVICE OPERATIONS



DATE: OCTOBER 10, 2025

Certain Maserati Grecale (M182) MY23 MY24 MY25 listed in MODISCS+ are involved in a Rapid Update to check the trim of the USB port in the center console.

Some trims may have weak or damaged retaining clips, which could cause them to detach. This is only a cosmetic issue— it does not affect vehicle safety or function.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.


Technical Procedure

 All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before starting, make sure to apply adequate protection to the interior on the vehicle to avoid damage.
3. Locate the USB port in the center console storage compartment.



4. Manually move the USB port by hand to check for a secure fitment. Try and move it in all directions to see if it feels loose or lifts.
5. Use a 3mm thick plastic trim tool or feeler gauge:
Gently try to insert it between the trim and the storage compartment wall (top and right sides).
- Use a light rotary motion—do not force the tool.
⚠ Be careful not to scratch the trim or interior.

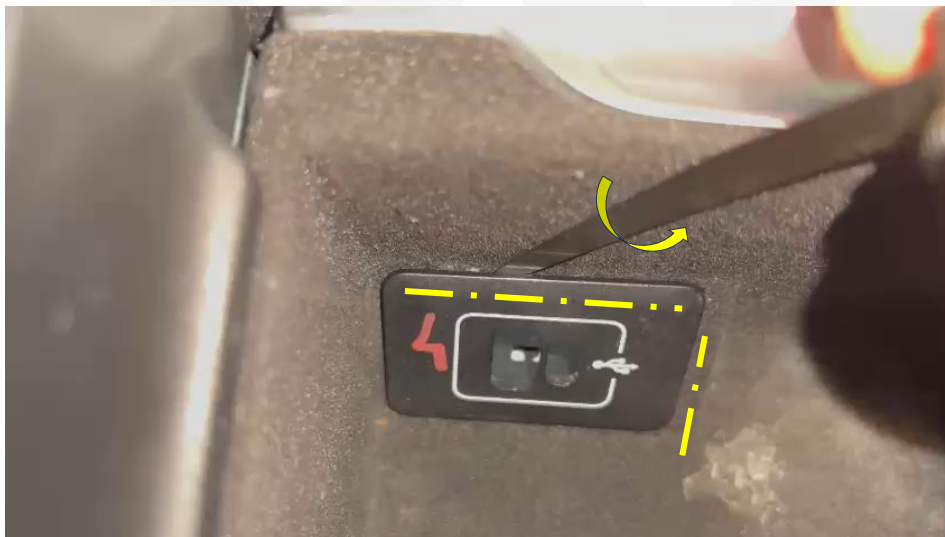

6. Evaluation:
 - If the gauge doesn't fit and the trim is secure → Vehicle is OK.
 - If the trim lifts or detaches → Replace the trim.
7. Reassemble all parts in reverse order after replacement.
8. Procedure complete.

Parts Information

Order and replace the following part **ONLY** if the trim lifts or detaches per step 6.

Description	Part Number	Amount
USB SOCKET TRIM	673015861	1

Warranty Information

Please complete the warranty claim as follows:

Description	Code
Rapid Update Number	788
Warranty code	23
Fault code	063
Component code	8.71.148
Operation code	
Check	8.71.148.A (0.05 h)
Replacement	8.71.148.B (0.05 h)