



I N F I N I T I

Nissan Group of the Americas  
Copyright ©

# TECHNICAL SERVICE BULLETIN

Classification:

DA25-004

Reference:

ITB25-011

Date:

October 7, 2025

## AEB WARNING WITH U2752-88 STORED IN ADAS CONTROL UNIT 2 AND/OR U275F-88 STORED IN THE DISTANCE SENSOR CONTROL UNIT

**APPLIED VEHICLES:** 2025 QX80 (Z63)

**APPLIED SYSTEMS:** AEB (Automatic Emergency Braking)

### IF YOU CONFIRM

The AEB warning was displayed, and one or both of the following DTCs stored as Current:

- U2752-88 for “Ethernet circuit” stored in the ADAS control unit 2.
- U275F-88 for “Ethernet circuit” stored in the Distance Sensor control unit.

**HINT:** The ESM shows U275F-88 as being stored in the LASER/RADAR control unit and in CONSULT 4 it is displayed as Distance Sensor.

### ACTION

1. Confirm the current Distance Sensor control unit part number.
2. Reprogram the Distance Sensor control unit, if applicable.

**IMPORTANT:** The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.

## SERVICE PROCEDURE

- Using CONSULT 4, confirm the current Distance Sensor control unit (ECU) part number and write it on the repair order.
  - If it matches one of the part numbers in **Table A**, continue to step 2 below.
  - If it does not match one of the part numbers in **Table A**, this bulletin does not apply. Go back to ASIST for further diagnostic and repair information.

**Table A**

MODEL	CURRENT ECU PART NUMBER: 988J0-
2025 QX80	7JA3A, 7JA3C

### **⚠ WARNING** **⚠ CAUTION** **NOTICE**

If you are not familiar with the CONSULT Reprogramming procedure, refer to the CONSULT Operation Manual and the Electronic Service Manual (ESM) for steps to reprogram an Electronic Control Unit (ECU). Follow all precautions in both manuals to prevent possible personal injury or death and/or damage to the ECU.

- Reprogram the Distance Sensor control unit.

**IMPORTANT:** When using CONSULT 4, follow the “Vehicle Menu” and select the **Vehicle reprogramming** option under “Tool Menu” to reprogram the ECU.
- After erasing all DTCs, print a copy of the CONSULT screen showing the before and after part numbers of the control unit and attach it to the repair order.

## CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Check the Current Part Number	(1)	RXJ3AA	ZE	32	0.3
Check Part Number & Reprogram the Distance Sensor Control Unit		RXJ4AA			0.5

- Reference the electronic parts catalog and use the Distance Sensor Assy 28437-\*\*\*\*\* as the Primary Failed Part (PFP).

## AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
October 7, 2025	ITB25-011	Original bulletin published

