



# Service Bulletin

Bulletin No.: PIP6084A

Date: October, 2025

## PRELIMINARY INFORMATION

**Subject: Service Parts and Procedures Now Released For Transmission Park Lock Valve Related Faults**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Corvette	2020-2025		All	All	All	M1L, M1M, MLH

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Previous repairs for Park Lock Valve related faults were repaired by replacing the transmission assembly as these parts were not released as a serviceable component. Now that we have parts, service procedures and diagnostics in place we will be servicing the PLV and Harness as needed to repair the vehicle instead of transmission assembly replacement.
<b>Cause</b>	23-NA-176 was created to catch intermittent issues related to park position. If the condition is current, status is "Undetermined State" with a position reading in-between 4.5 mm and 6.5 mm it is currently failed and does not require the born-on position to be verified. Follow published diagnostics and repairs. For intermittent conditions we can still check the born-on position. 23-NA-197 checks born on position to prevent making repairs on a transmission that would have had to be replaced. Now that we can service park it may be determined that park pawl actuator needs to be replaced in conjunction with repairs being made.

### Correction

If born position is checked through TAC and determined that the park pawl actuator needs to be replaced, or published diagnostics lead to replacement, here are some helpful tips.

Park pawl actuator replacement doc id 6837160

Emerging issues video 12/2024 (U.S. COL # 10224.12V Canada COL # 57570.01V) start at the 43-minute mark shows you what you are trying to accomplish when feeding the park rod back into the transmission.

Transmission control module will need to be programmed with a VCI number from techline.

The new park pawl actuator will need to be fine-tuned to this transmission, and the calibration allows for the learn to be performed

Park pawl actuator PUN will need to be characterized so take a picture of the PUN, it is 22 digits and etched/printed very small. If the PUN is not characterized the vehicle may not start and we have to be able to start the vehicle to perform the relearn. I cannot stress enough to make sure you get the correct PUN, if not the transmission will have to come back out to get the number. It starts with PO.

Will need to run park lock valve learn after transmission control module reprogram and characterization, improper calibrations in the TCM will result in a failure 2F01 when attempting to run the learn.

The harness part number is 24066648 and will need to be replaced as well if any retainers are broken when removing.

## Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8462920	Park Pawl Actuator Replacement	Use published labor time

Version	2
Modified	09/05/2025 Created on. 10/06/2025 Added COL numbers for U.S. and Canada

