



GROUP	MODEL
BOD	2021-2024MY Seltos (SP2)
NUMBER	DATE
326 (Rev 1, 10/20/2025)	July 2024


TECHNICAL SERVICE BULLETIN

HORN ASSEMBLY INSPECTION/REPLACEMENT

NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides information associated with the 'Warranty Extension Program' (WTY038) to inspect and, if necessary, replace the horn assembly on 2021-2024MY Seltos (SP2) vehicles produced from March 21, 2019 through June 21, 2024. The affected vehicles may experience a distorted or an inoperative horn sound caused by corrosion and dust inside the horn assembly. The warranty coverage for repairs related to the horn assembly has been extended from 5 years / 60,000 miles to 10 years / 120,000 miles, whichever comes first, starting from the date the vehicle was first put into service. Follow the procedure outlined in this publication to inspect and, if necessary, replace the horn assembly with a new one.

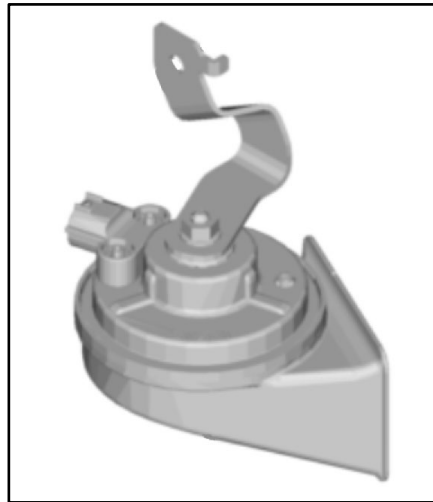

NOTICE

A Technical Service Bulletin is a field fix repair program without customer notification that may be performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Inspection Procedure:

- Press the Horn Pad to confirm normal operation.
 - If the horn operates **normally**, this TSB does not apply. **Claim inspection only labor op 242044R1.**
 - If the horn is **inoperative** or the **tone is distorted**, proceed to the 'Replacement Procedure' below.



**Replacement Procedure:****NOTICE**

The replacement horn has reversed polarity compared to the original. Use the supplied extension harness to ensure proper connection.

- Replace the Horn (B) by referring to "Body Electrical System → Horn → Repair procedures" in the applicable Shop Manual on KGIS.
 - 21-23MY Seltos**
96611 Q5000QQK or **96641 Q5000QQK***
 - 2024MY Seltos**
96611 Q5100QQK or **96641 Q5200QQK**

21-23MY ONLY: If replacing the horn with **PN 96641 Q5000QQK*, it is required that the wiring harness extension (B) is also replaced simultaneously.**

- Reinstall all removed parts in the reverse order of removal.
- Confirm normal operation of the horn.

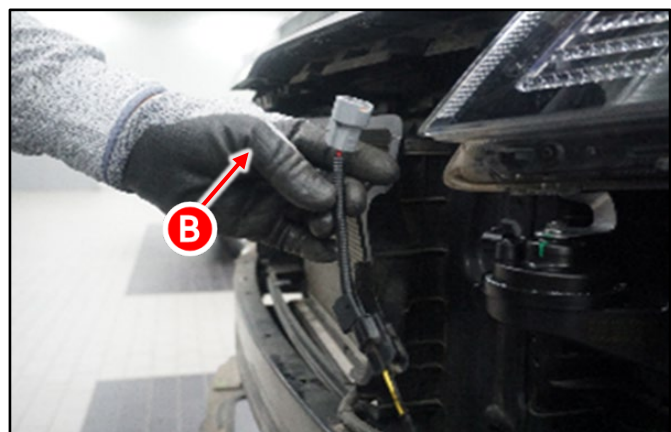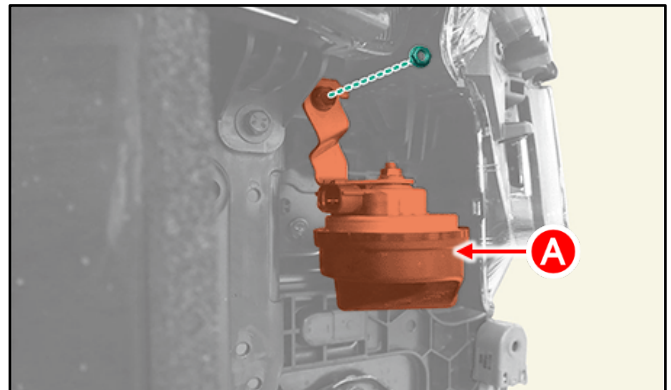

SUBJECT:

HORN ASSEMBLY REPLACEMENT

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Seltos (SP2)	March 21, 2019 to June 21, 2024

REQUIRED PART:

Part Name	Model Year	Part Number	Figure	Qty.	Comments
Horn Assembly	21-23MY	96611 Q5000QQK or 96641 Q5000QQK*		1	PN 96611 Q5000QQK (The Wiring Harness Extension is <u>not</u> required)
Wiring Harness Extension	21-23MY	96619 K2100QQK*		1	Required ONLY when ordering replacement horn PN 96641 Q5000QQK*
Horn Assembly	24MY	96611 Q5100QQK** or 96641 Q5200QQK		1	PN 96611 Q5100QQK** Cannot be ordered but Some inventory may Be in dealer stock.

Note: The replacement part numbers will require a VIN entry for parts ordering. DO NOT order these parts for stocking purposes, related to this Campaign. Supply is very limited. Until supply stabilizes, please confirm part availability before scheduling customers. Please be sure to expedite warranty claim filing. ****If the servicing dealer has inventory for the previous horn PN: 96611 Q5100QQK used in this TSB before it was revised, then the dealer may submit claim using the older part. The wiring harness extension is not required for this part number.**

SUBJECT: **HORN ASSEMBLY REPLACEMENT**

WARRANTY INFORMATION:

N Code: I11 C Code: ZZ3

Claim Type	MY	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	21-23 MY	96611 Q5000	0	Inspection Only	242044R1	0.1 M/H	N/A	0
	24MY	96611 Q5100						

Claim Type	Model Year	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	21-23 MY	96611 Q5000	0	Inspection + Horn Assembly Replacement	242044R3	0.5 M/H	96611 Q5000QK or 96641 Q5000QK and 96619 K2100QK	1
	24MY	96611 Q5100					96641 Q5200QK	1

For Substitute Transportation policy, please refer to [Service Policy and Procedures Manual \(SPPM\) 6.11 "Kia Substitute Transportation"](#). If the servicing dealer has remaining inventory for the previously listed horn Part Number 96611 Q5100QK (applicable to all 21-24MY vehicles), then the dealer may submit claim using the older part.

