



## **SSM 54313 2020-2025 Various Vehicles - Inoperative Blind Spot Monitoring With "Blind Spot System Fault" Message In The IPC**

Some 2020-2025 various Ford and Lincoln vehicles equipped with blind spot information system (BLIS) may experience an inoperative blind spot monitoring with a "Blind Spot System Fault" message displayed in the instrument panel cluster (IPC). This may also be accompanied by diagnostic trouble codes (DTCs) B118C:11 and/or B118C:15 stored in the driver door module (DDM), and/or B118D:11 and/or B118D:15 stored in the passenger door module (PDM). This may be due to the wiring connector from the mirror to the BLIS module. If diagnostics lead to an internal mirror wiring harness fault, a new lower level BLIS light pigtail is now released for service. It is not necessary to replace the exterior mirror assembly. Use part number SC3Z-14A411-B to resolve the concern.