

**Technical Service Bulletin (TSB)**  
**Security Gateway Module (SGW) Software Update**

<b>REFERENCE:</b>	<b>TSB:</b> 08-336-25 REV. A <b>GROUP:</b> 08 - Electrical	<b>Date:</b>	October 22, 2025	<b>REVISION:</b>	08-336-25
<b>VEHICLES AFFECTED:</b>	<b>2025 (WL) Jeep Grand Cheekee/ Grand Cherokee L</b> <b>This bulletin applies to vehicles built on or after <b>**April 07, 2025 (MDH 0407XX)**</b> and on or before July 25, 2025 (MDH 0725XX).</b>			<b>MARKET APPLICABILITY:</b> <input checked="" type="checkbox"/> NA <input checked="" type="checkbox"/> <b>**IAP**</b> <input checked="" type="checkbox"/> <b>**SA**</b> <input type="checkbox"/> CH <input checked="" type="checkbox"/> <b>**EE**</b> <input checked="" type="checkbox"/> <b>**MEA**</b> <b>NOTE: This bulletin applies to the North and <b>**South America, Enlarged Europe, Middle East &amp; Africa and India &amp; Asia Pacific**</b> market.</b>	
<b>CUSTOMER SYMPTOM:</b>	<p><b>Customers may experience <b>**one or more of <b>**the following:</b></b></b></p> <ul style="list-style-type: none"> <li><b>**Connectivity services will not work - including WIFI setup, Alexa, live traffic etc. Level 2 Plus functionality also affected/not enabling.</b></li> <li><b>SGW not responding to diagnostic and showing offline.**</b></li> <li><b>Wifi cannot be setup.</b></li> </ul> <p><b>The following software enhancements are also available:</b></p> <ul style="list-style-type: none"> <li><b>Diagnostic Trouble Code (DTC) U3033-00 - Control Module Security Certificate Missing/Invalid and <b>**U3033-01 - Control Module Security Certificate Missing/Invalid - General Electrical Failure**</b> are both active or stored and cannot clear. <b>This DTC will not turn on the Malfunction Indicator Light (MIL).</b></b></li> <li><b>If a Firmware Over The Air (FOTA) message appears specifically directing the customer to service OR repeated FOTA events are not being completed, then a manual flash is required for the SGW update.</b></li> <li><b>SGW module is not responding to diagnostics and is showing offline.</b></li> </ul>				
<b>CAUSE:</b>	<b>SGW software flash</b>				

**This bulletin supersedes Technical Service Bulletin (TSB) 08-336-25, date of issue October 08, 2025, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include new Market Applicability, Market Applicability note, Vehicle build date, Customer Symptoms statement, Customer Symptoms, Software Enhancement, Repair Summary verbiage, LOP, Claims Table Failure Code, Repair Procedure steps and turning this bulletin into an RSU.**

**\*\*This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-200, date of issue October 22, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.\*\***

**REPAIR SUMMARY:**

This bulletin involves **\*\*inspecting and possibly\*\*** flashing the SGW to the latest software level in the case that the FOTA did not function.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
**18-19-F8-92	Module, Security Gateway - Inspect (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs. **
18-19-F8-91	Module, Security Gateway - Inspect and Reprogram (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Codes	**RF	Required Flash**	
	CC	Customer Concern	

**\*\*The dealer must choose which failure code to use depending on if this is a Rapid Service Update (RSU) or Technical Service Bulletin.**

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RSU.
- The failure code “RF” (Required Flash) can no longer be used on Technical Service Bulletin flashes. The “RF” failure code must be used on an RSU.
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Technical Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.\*\*

**SPECIAL TOOLS/EQUIPMENT:**

Description	Ref. No.	Notes
wiTECH or equivalent	-	-

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

**REPAIR PROCEDURE:**

1. **\*\*Is the vehicle on the RSU VIN list?**
  - YES>>> Proceed to [Step 2](#).
  - NO>>> Proceed to [Step 3](#).

2. Is the SGW software updated to the latest level?
  - YES>>> This bulletin is complete. Use Inspect LOP (18-19-F8-92) to close this active RSU.
  - NO>>> Proceed to [Step 3](#).\*\*
3. Reprogram the SGW with the latest software. If issues arise when flashing a module using the wiTECH Diagnostic Application, please submit a ticket to the Helpdesk. The helpdesk can be found within the Help menu.
4. Clear all DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

**POLICY:**

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*