



Service Bulletin

Bulletin No.: PIP6071B

Date: October, 2025

PRELIMINARY INFORMATION

Subject: Potential Chuggle, Surge, Hesitation on Acceleration, Misfire, P0300, P2097, P2251, P223C

| Brand: | Model: | Model Year: | | VIN: | | Engine: | Transmission: |
|-----------|---------|-------------|----|------|-----|---------|---------------|
| | | from | to | from | to | | |
| Chevrolet | Equinox | 2023-2026 | | All | All | 1.5 LSD | All |
| GMC | Terrain | 2023-2026 | | All | All | 1.5 LSD | All |

| | |
|-----------------------------------|--|
| Involved Region or Country | North America |
| Condition | Customers may notice a surge, misfire, chuggle, hesitation at tip in acceleration or MIL with P0300, P2097, P2251 P223C stored. More noticeable on units built prior to April 1, 2025. |
| Cause | Potential skewed position 1 oxygen sensor. |

Correction

Replace the position 1 oxygen sensor, perform any applicable learn, and retest. Inspect the catalytic converter while sensor is out of the bore for any potential degradation to the catalyst bed.

Parts Information

Refer to GM EPC for parts information per specific VIN.

| | |
|-----------------|---|
| Version | 3 |
| Modified | 06/13/2025 created on. 06/30/2025 Update to add Model Year 2026. 10/20/25 Update to the condition |

