



Service Bulletin

Bulletin No.: PIT6234A

Date: October, 2025

PRELIMINARY INFORMATION


Subject:

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2021 - 2026		All	All	All	All
Cadillac	Escalade ESV	2021 - 2026		All	All	All	All
Chevrolet	Silverado 1500 New (RPO J22, VIN Digit 5 = A or D)	2022		All	All	All	All
Chevrolet	Silverado 1500	2023-2026		All	All	All	All
Chevrolet	Silverado 2500	2024-2026		All	All	All	All
Chevrolet	Silverado 3500	2024-2026		All	All	All	All
Chevrolet	Suburban	2021 - 2026		All	All	All	All
Chevrolet	Tahoe	2021 - 2026		All	All	All	All
GMC	Sierra 1500 New (RPO J22, VIN Digit 5 = H or U)	2022		All	All	All	All
GMC	Sierra 1500	2023-2026		All	All	All	All
GMC	Sierra 2500	2024-2026		All	All	All	All
GMC	Sierra 3500	2024-2026		All	All	All	All
GMC	Yukon	2021 - 2026		All	All	All	All
GMC	Yukon XL	2021 - 2026		All	All	All	All

Involved Region or Country	North America
Condition	Some customers may state after starting the vehicle and shifting into gear that the vehicle goes back into park and then completely shuts down like the ignition is turned off. At this point, this has not been known to be an intermittent issue and will happen every time.
Cause	The cause of this condition could be an aftermarket device, as shown below. This device has been found to be installed behind the ignition mode (start) button and also down near the SDGM and BCM. When installed it has been taped to the wiring harness and wrapped in factory looking felt tape making it difficult to locate.



6730520

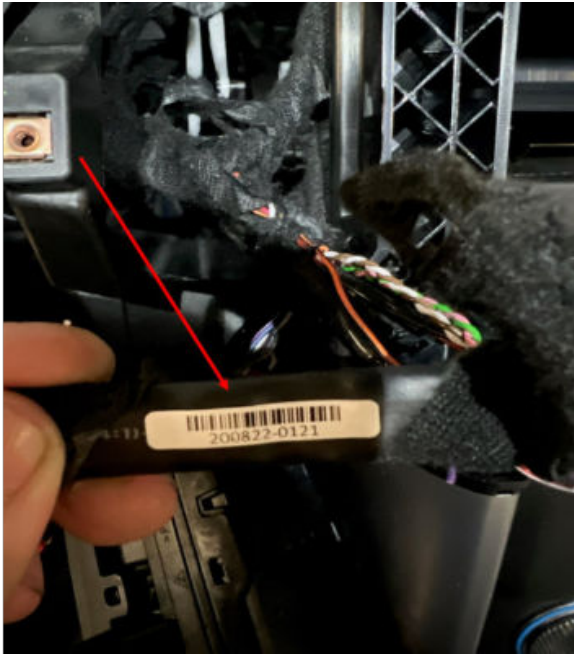

6730521



6730522

Correction

Inspect the vehicle for any aftermarket devices and remove before any further diagnoses.

Warranty Information

Warranty Information

Warranty coverage does not extend to problems created by aftermarket devices. Damage to normally covered systems caused by aftermarket products is the responsibility of the customer or the aftermarket installer.

Version	2
Modified	09/10/2024 - Created on. 10/22/2025 - Update to the models

