



# Service Bulletin

Bulletin No.: PIT6448

Date: ? , ?

## PRELIMINARY INFORMATION

**Subject:** Information on Airbag Front End Sensor Replacement

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Express	2008 - 2015		All	All	All	All
GMC	Savana	2008 - 2015		All	All	All	All

<b>Involved Region or Country</b>	All Regions
<b>Condition</b>	New replacement SIR airbag front end sensors do not include the mounting fastener, and some questions have been asked if the old fastener can be reused.
<b>Cause</b>	Mounting fastener not included with new replacement sensor.

### Correction

Please reuse the original equipment (OE) installed fastener, provided it passes the following inspection criteria:

- Corrosion Check: Inspect for rust, pitting, or any signs of corrosion that may compromise the fastener's strength.
- Damage Assessment: Look for cracks, bending, deformation, or stripped threads. Any such damage may render the fastener unsuitable for reuse.
- Reference Service Procedure: For additional guidance, refer to the Fastener Caution section within the applicable service procedure.

### Fastener Caution

**Caution:** Use the correct fastener in the correct location. Replacement fasteners must be the correct part number for that application. Do not use paints, lubricants, or corrosion inhibitors on fasteners, or fastener joint surfaces, unless specified. These coatings affect fastener torque and joint clamping force and may damage the fastener. Use the correct tightening sequence and specifications when installing fasteners in order to avoid damage to parts and systems. When using fasteners that are threaded directly into plastic, use extreme care not to strip the mating plastic part(s). Use hand tools only, and do not use any kind of impact or power tools. Fastener should be hand tightened, fully seated, and not stripped.

If the fastener is not reuseable do not order the SPAC part, it will not have the fastener.

This Fastener should be available in January or February of 2026

Follow service information for the proper repair instruction

**Note:** Integral sensor assembly bolt uses Left Hand threads. Use counterclockwise rotation to loosen fastener at TORX® tip end. If accessing at pan head end of the fastener, use clockwise rotation to loosen bolt. Tighten the nut (1) to 10 Y (89 lb in) +/- 0.5

Version	1
Modified	10/30/2025 - Created on

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION