

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



| | |
|---|---------------------------------|
| Subject: FRONT INNER BRAKE PAD PREMATURE WEAR | Bulletin No.: 04-003/25 |
| | Last Issued : 10/01/2025 |

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2022-2023 MX-30

DESCRIPTION

Some vehicles may experience premature wear of the front inner brake pads. The pads wear down by about 0.1 in (3 mm) every 6200 miles (10,000 km), and may require replacement at less than 12,400 miles (20,000 km). This is caused by intrusion of dirt and sand into the gap between the pad and the rotor. To eliminate this concern, the shape of the dust cover has been changed.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the brake pads, and both dust covers with modified ones, instructions in MGSS (WHEEL HUB, STEERING KNUCKLE REMOVAL/INSTALLATION).
3. Verify the repair.

PARTS INFORMATION

| Parts Number | Description | Qty. | Notes |
|--------------|---------------------------|------|-------|
| D69R-33-261 | Cover-Dust, F RH | 1 | |
| D69R-33-271 | Cover-Dust, F LH | 1 | |
| D651-33-042A | Nut | 2 | [R] |
| T060-26-169A | Pin Snap | 2 | [R] |
| DNYJ-33-28ZD | Pad, Sub Set, Frt Caliper | 1 | |

[R]: Replacement parts

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

WARRANTY INFORMATION**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

| | |
|---------------------------------|---------------------|
| Warranty Type | A |
| Symptom Code | 94 |
| Damage Code | 9C |
| Part Number Main Cause | 7777-SP-Y48 |
| Quantity | 0 |
| Operation Number / Labor Hours: | XXWRNXRX / 0.8 Hrs. |

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.