



Service Bulletin

Bulletin No.: 25-NA-127

Date: May, 2025

TECHNICAL

Subject: Air Inlet Panel Extension Assembly May Become Disengaged After Hood Open Beyond the Prop Rod Height

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2023	2025	-	-	All	All
GMC	Canyon	2023	2025	-	-	All	All

Involved Region or Country	North America, Middle East, S. Korea
Condition	 <p data-bbox="528 1547 1485 1608">Some customers may notice that the air inlet grille panel extension on the right or left side may have become disengaged from the center air inlet grille panel. 6934009</p>



6934010


These customers may also notice a gap between these components.
This may also occur if the hood has been opened recently beyond the prop rod height.

Cause	The cause of this condition may be that the hood has been raised excessively beyond the prop rod engagement point. The result is hard interference between hood hinge and air inlet grille panel extension consequentially leading to the extensions detaching from the air inlet grille panel.
Correction	Refer to the procedure below to correct this condition.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.


Service Procedure

Inspect the air inlet grille panel extension clip tab for damage.

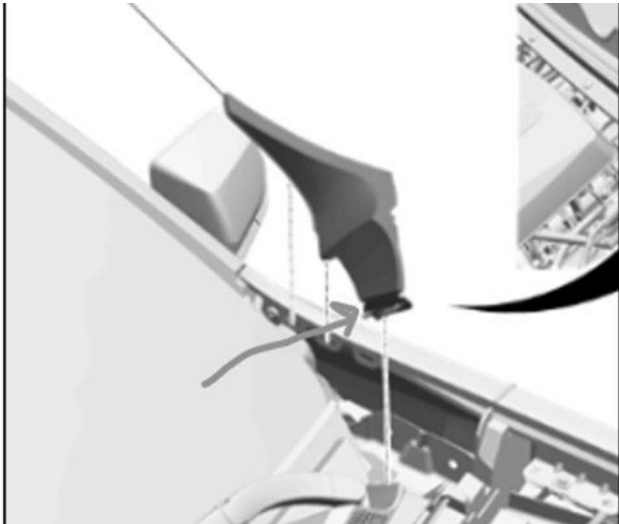

6934011

If damage exists, the affected air inlet grille panel extension must be replaced. Refer to Air Inlet Grille Panel Extension Replacement in SI. (see image on specific clip)

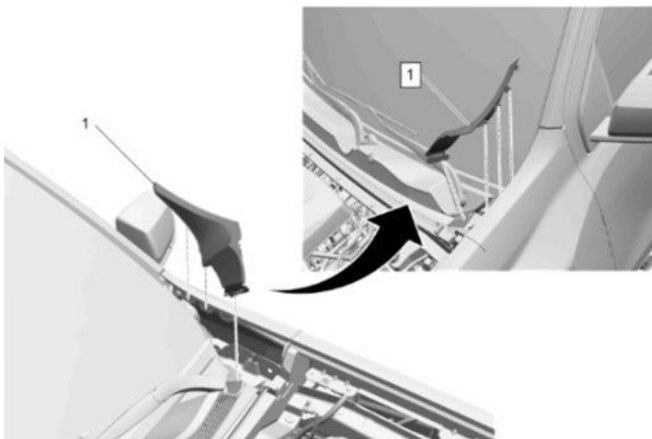

6934012

If there is no damage to the affected air inlet grille panel extension, reattach the air inlet grille panel extension to the air inlet grille panel. Refer to Air Inlet Grille Panel Extension Replacement in SI.

Important: Hood should not be raised more than 100 mm past hold open rod height. Going past 100 mm may cause the air inlet grille panel extensions to disengage. Damage may result. Please share this information with the Customer.

Parts Information

Causal Part	Description	Part Number	Side
X	EXTENSION ASM-AIR INL GRL PNL	85670001	Left
X	EXTENSION ASM-AIR INL GRL PNL	85670002	Right

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*1080548	Air Inlet Grille Panel Extension Reinstall	0.2
or		
2070830	Air Inlet Grille Panel Extension Replacement	Use Published Labor Operation Time
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released May 15, 2025

