

**Technical Service Bulletin (TSB)**  
**Catalytic Converter Replacement Warranty Extension XY1**

<b>REFERENCE:</b>	<b>TSB:</b> 11-003-25 <b>GROUP:</b> 11 - Exhaust System	<b>Date:</b>	October 28, 2025	<b>REVISION:</b>	—
<b>VEHICLES AFFECTED:</b>	<b>2023 - 2025 (H6) Jeep Meridian</b> <b>2023 - 2025 (M6) Jeep Compass</b> This bulletin applies to vehicles built on or after March 02, 2023 (MDH 0302XX) and on or before July 31, 2025 (MDH 0731XX) equipped with a 2.0L I4 Turbo Diesel Engine W/ ESS (Sales Code EBS).			<b>MARKET APPLICABILITY:</b> <input type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input checked="" type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH <b>NOTE: This bulletin applies to the India and Asia Pacific markets.</b>	
<b>CUSTOMER SYMPTOM:</b>	<p><b>Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must exhibit/set the following Diagnostic Trouble Code (DTC):</b></p> <ul style="list-style-type: none"> <li>● P2002-00 - Diesel Particulate Filter Flow Resistance Monitoring Too High Level 2 Component Or System Operation Obstructed Or Blocked.</li> </ul> <p><b>Customers may also comment on the following:</b></p> <ul style="list-style-type: none"> <li>● The vehicle is in limp mode and will not exceed 100 kph (62 mph) speed.</li> </ul> <p><b>NOTE: The Customer Symptoms listed apply to the India market only.</b></p>				
<b>CAUSE:</b>	Software issue				

**REPAIR SUMMARY:**

This bulletin involves replacing the catalytic converter.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
11-50-01-9Y	Catalytic Converter - Replace (0 - Introduction)	1 - Engine Repair and Performance	0.8 Hrs.
Failure Code	ZZ	Service Action	

## SPARE PARTS:

Qty	Part No.	Description	Notes
1	K68566622AA	Silencer Catalized Exhaust	Catalytic Converter
1 (AR)	68081364AA	Gasket, Catalytic Converter	(X87)
1 (AR)	68282995AA	Gasket, Catalytic Converter	(X87)
1 (AR)	68166248AA	Gasket, Exhaust	(X87)
1 (AR)	68338473AA	Gasket, Exhaust	(XAL)

## DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition above, perform the repair procedure.

## SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	–	–

## REPAIR PROCEDURE:

1. Replace the catalytic converter. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info> 11 - Exhaust System / Catalyst, Selective Catalytic Reduction (SCR) / Removal and Installation.
2. Clear all DTCs that may have been set.

## POLICY:

Warranty Extension to extend the current warranty period to one year from vehicles in-service date. See Warranty Bulletin: India ID-25-16, for details associated with the Warranty Extension.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*