

## GPOP - Issue Review System

**Part Number:** 68548293A\$, 68548294A\$, 68595832A\$

**Part Description:** Ignition switch

**Issue Description:** Please refer SOL "S2508000083" published in October 2025. DO NOT REPLACE KIN/ignition switch module PN 68548293A\*, 68548293A\*, 68595832AA due to stored RFH DTC B1A7D-2A:  
Start Button-Stuck, P05BD:  
STOP-START MODE SWITCH RANGE/PERFORMANCE Please do not replace KIN/ignition switch module if all the following conditions are TRUE 1-3. 1. Stored RFH DTC B1A7D-2A:  
Start Button-Stuck 2. No functional issues observed or reported 3. Don't replace KIN if you find the DTC P05BD:  
STOP-START MODE SWITCH RANGE/PERFORMANCE. THIS IS NOT a KIN DTC. This DTC is related to the Electronic Shift Module- stop start on off button