



IMPORTANT SERVICE INFORMATION FOR:
✓ SERVICE MANAGER
✓ SERVICE ADVISOR
✓ TECHNICIAN
✓ PARTS DEPARTMENT
✓ WARRANTY PERSONNEL

BULLETIN NUMBER
SB25-J-001

ISSUE DATE
OCTOBER 2025

GROUP:
ENGINE

CHARGE AIR COOLER (CAC) HOSE CLIP INSTALLATION

AFFECTED VEHICLES

- 2022-2026MY Isuzu F-Series Vehicles
With a production date prior to 8/4/2025

INFORMATION

Some customers may complain about a whistling noise from the engine, lack of power, or a visible alarm from the check engine malfunction indicator light (MIL). Dealers may find that this issue is caused by a hole in the Charge Air Cooler (CAC) hose near the compressor inlet hose. Whenever the CAC hose is replaced, Isuzu recommends dealers also install a new hose clip to prevent the compressor hose from damaging the new CAC hose in the future.

Follow the installation procedure below to install the new hose clip.

PARTS INFORMATION

F-Series Charge Air Cooler Repair Parts		
Part Number	Description	Quantity Required
7552717250	Clip; Hose (Zip Tie)	2
7552717260	Clip; Hose	1

INSTALLATION PROCEDURE

- After completing the installation of the new CAC hose per the WSM, place the hose clip directly below the hose clamp and secure with one (1) zip tie as shown in Figure 1.



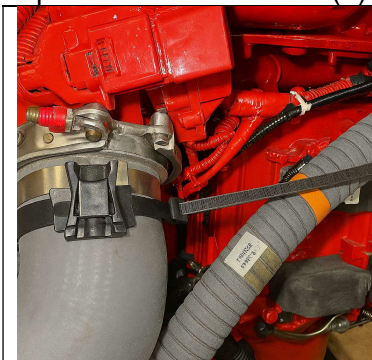


Figure 1


2. Trim the excess zip tie.
3. Turn the hose clip so that the clip is facing up. See Figures 2 and 3.

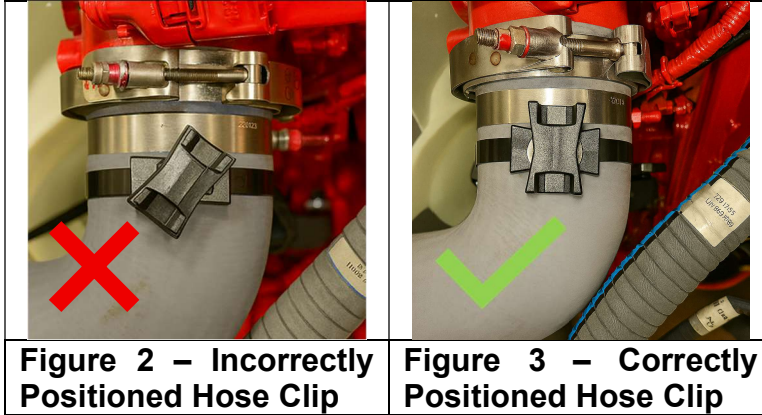

4. Insert the zip tie into the top of the clip. See Figure 4.

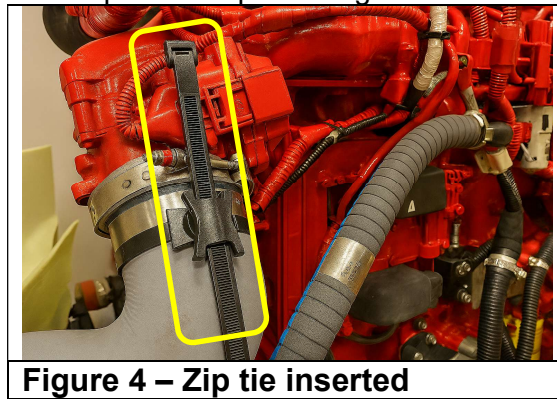

5. Lay the compressor inlet hose on top of the hose clip installed in Step 4 and tighten the zip tie. See Figure 5.

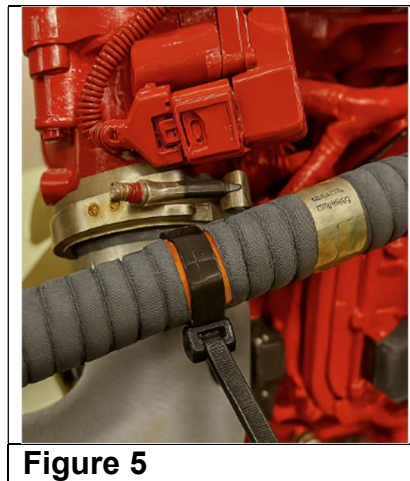

6. Trim the excess zip tie.
7. Squeeze the release handle on the cab tilt stay and lower the cab.

WARRANTY INFORMATION

Labor Code	Description	Labor Hours
J5692	CAC Hose Replacement ADD: Install Hose Clip	See published time. 0.1

