

Technical Service Bulletin

Topic	96 Various messages relating to driver assist systems, event memory entry U110100 logged in various control units
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Audi
Transaction No.	2079729/1
Level	EH
Status	Released for publishing
Release date	Oct 22, 2025

Diagnostic trouble codes

Diagnostic address	Diagnostic trouble code	Fault symptom	Storage state
8109 - Short-range radar 1	U110100: Component protection active		static
810A - Short-range radar 2	U110100: Component protection active		static
810C - Short-range radar 4	U110100: Component protection active		static
0013 - Adaptive cruise control	U110100: Component protection active		static
008B - Distance regulation 2	U110100: Component protection active		static
810B - Short-range radar 3	U110100: Component protection active		static

New customer code

Object of complaint	Complaint type	Position
assistance systems, comfort controls -> cross-traffic assist -> cross-traffic warning caused by an object	functionality -> no function	
information, navigation, communication, entertainment -> indicator display symbols -> exit warning system indicator display	functionality -> activates	
assistance systems, comfort controls -> exit warning system -> exit warning caused by an object	functionality -> no function	
information, navigation, communication, entertainment -> driver information system (DIS, MFI, MMI) -> text display	functionality -> activates	
assistance systems, comfort controls -> cross-traffic assist -> cross-traffic assist monitoring mode activation	functionality -> no function	
assistance systems, comfort controls -> emergency braking function -> automatic emergency braking (Front Assist)	functionality -> no function	
assistance systems, comfort controls -> lane change assistance -> lane change assist monitoring mode activation	functionality -> no function	
information, navigation, communication, entertainment -> warning display symbols -> active warning warning display	functionality -> activates	
information, navigation, communication, entertainment -> driver information system (DIS, MFI, MMI) -> text display	functionality -> activates without cause	
assistance systems, comfort controls -> exit warning system -> exit warning system monitoring mode activation	functionality -> no function	

Vehicle data

Audi Q6

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
GF*	2025	A		*	*	*

Control units

Diagnostic address	Software part number	Software version	Hardware part number	Hardware version
0009 - Electronic central electric	*	1437	*	*
0009 - Electronic central electric	*	1436	*	*
0009 - Electronic central electric	*	1496	*	*

Documents

Document name
master.xml
schnellerebearbeitung.jpg

Condition

Customer states:

Various messages relating to driver assist systems.

Workshop findings:

The customer statement can be reproduced.

The entry **“U110100: Component protection active, active/static, symptom: 1231633”** is logged in one or more event memories of the short-range radars (diagnostic addresses 8109, 810A, 810B, 810C) and/or adaptive cruise control units (diagnostic addresses 0013, 008B).

Technical Background

Due to a software issue in onboard supply control unit -J519- (diagnostic address 0009), the component protection in the short-range radars is no longer deactivated.

Functional issues occur when component protection is active.

Production Solution

Production change in the fourth quarter of 2025.

Service

This TSB replaces Pending Service Solution (PSS) TSB 2078209: *91 PSS Various messages relating to driver assist systems, event memory entry U110100 logged in various control units* for Q6 e-tron vehicles.

Please check whether TSB 2079690, *00 Combined software update 03.10.00/C (28.13.01) KD2* is visible for this vehicle. If this is the case, please perform the software update described in TSB 2079690.



The software update described in TSB 2079690 will be released in stages for the individual vehicle models/markets, depending on availability.

Warranty

Replacing parts will not fix the problem. If parts are replaced without good reason, they will be charged back.

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.
Service Number:	9710
Damage Code:	KD02
Labor Operations:	Please use the accounting instructions and labor times specified in TSB 2079690, <i>00 Combined software update 03.10.00/C (28.13.01) KD2</i> .

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2079729**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©**2025 Audi of America, Inc.** All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.