



SSM 54362 2021-2025 Bronco - Illuminated Red Brake Warning Indicator With DTC C0049:01 In The ABS Module

Some 2021-2025 Bronco vehicles may exhibit an illuminated red brake warning indicator with diagnostic trouble code (DTC) C0049:01 stored in the anti-lock brake system (ABS) module. Replace the brake fluid reservoir and the brake fluid level sensor electrical connector. Do not disconnect the brake fluid level sensor electrical connector, cut the connector 3-4 inches (75-100 mm) from the connector end and leave the brake fluid level sensor electrical connector attached to brake fluid reservoir. Include these parts in the same package when returning warranty replacement brake fluid reservoirs. The brake fluid reservoir with the electrical connector still connected should be packaged in the original box to protect it during shipping. For claiming, use causal part 2L210 and labor operations 2140A and 2219D45WR.