



GROUP
BOD

MODEL
2011-2015MY
Sorento (XMa)

NUMBER
205 (Rev 3, 11/12/2025)

DATE
March 2020

TECHNICAL SERVICE BULLETIN

SUBJECT:

OCCUPANT DETECTION SYSTEM (ODS) SENSOR PAD REPLACEMENT

★ NOTICE

This bulletin has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This bulletin provides the procedure to replace the front passenger Occupant Detection System (ODS) Sensor Pad on 2011-2015MY Sorento (XMa) vehicles produced from September 24, 2009 through December 11, 2014. If the Occupant Detection System (ODS) Sensor Pad is not operating properly, the airbag warning light will illuminate and the following DTC(s) may be stored:

Model	MY	DTC
Sorento (XMa)	2011 - 2013	B1763, B1764 and/or B1765
	2014 – 2015	B149000, B149300 and/or B149400

If the airbag warning light is illuminated and one or more of the above DTCs are stored, follow the procedure outlined in this bulletin to replace the passenger seat cushion ODS pad.



★ NOTICE

Replacement of the complete seat cushion assembly for this concern is not required. Warranty claims submitted for seat cushion assemblies will be subject to chargeback.


Printed TSB copy is for reference only; information may be updated at any time.
Always refer to KGIS for the latest information.

Circulate To: ☒ General Manager ☒ Service Manager ☒ Parts Manager
☒ Service Advisors ☒ Technicians ☒ Body Shop Manager ☒ Fleet Repair



OCCUPANT DETECTION SYSTEM (ODS) SEAT PAD - PARTIAL REPLACEMENT

Repair Procedure:


1. Remove the seat cushion cover by referring to the "Body (Interior and Exterior) → Seat & Power Seat → Front Seat → Repair procedures" chapter in the applicable Shop Manual on KGIS.

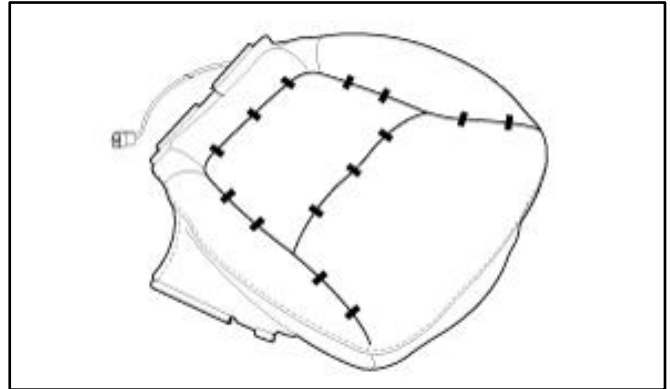


2. Using wire cutters, cut the nine (9) ODS retaining pad (A) clips (B).

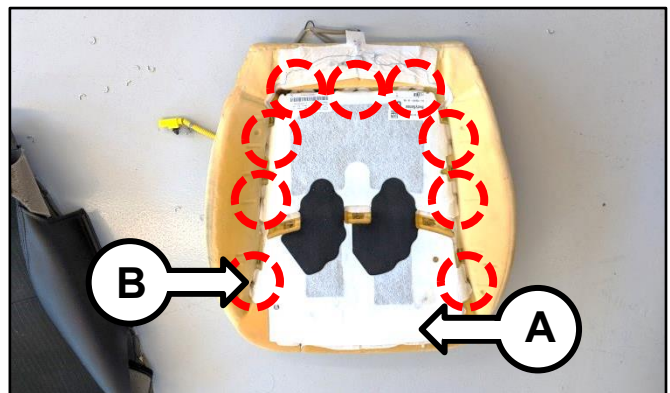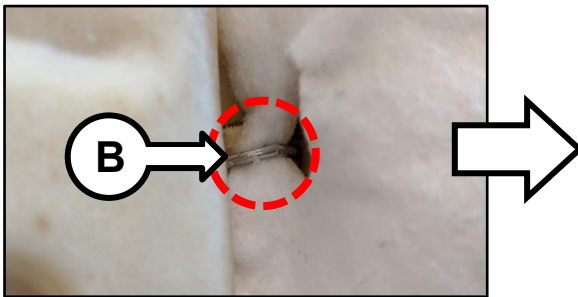

3. Using a heat gun, carefully apply heat to the front pad area shown to loosen the adhesive backing from the ODS sensor pad.

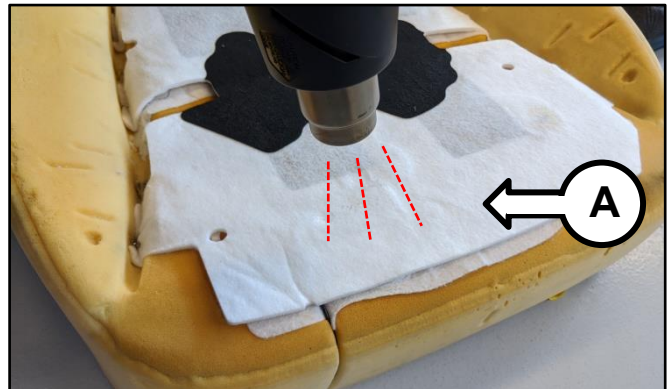


4. On the reverse side of the seat cushion, using a heat gun, apply heat to the ODS Module (C) to **carefully** remove it from the seat cushion.

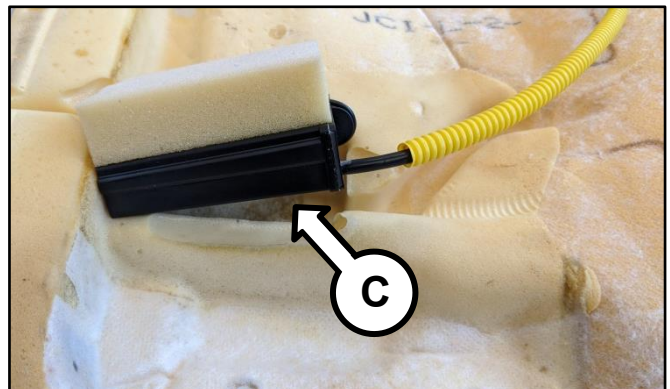

OCCUPANT DETECTION SYSTEM (ODS) SEAT PAD - PARTIAL REPLACEMENT

9. Turn the seat cushion over, insert and adhere the ODS module back onto the bottom of the seat cushion.


Note: Ensure that the coax cable is still properly inserted through the seat cushion cutaway.

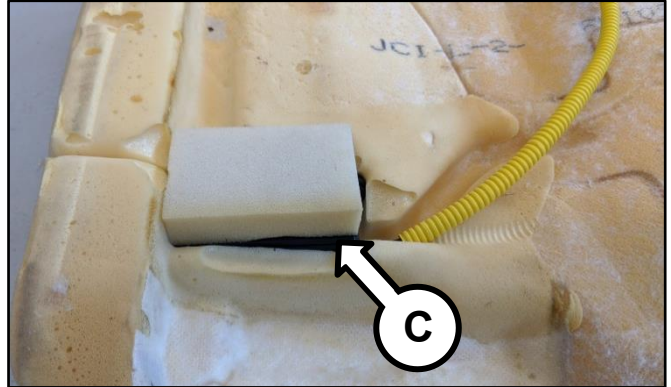

10. Reinstall the bottom seat cover in the reverse order of removal.

* NOTICE

The SST 09880 4F000A will be needed to secure the seat cover back onto the seat cushion. Refer to step 8 for crimping instructions.

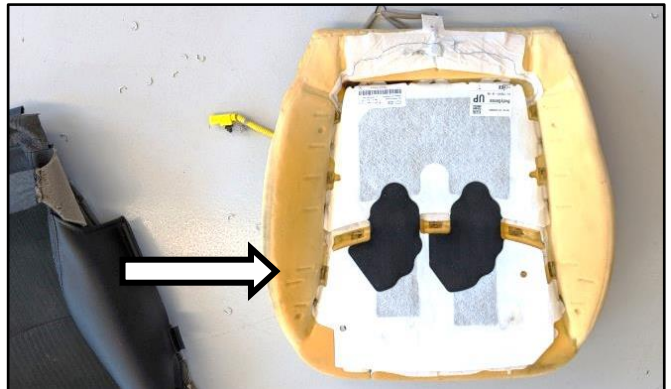

11. Reinstall all other removed parts in the reverse order of removal.

12. Confirm heated seat and ODS sensor pad is operating as designed.

SUBJECT:

OCCUPANT DETECTION SYSTEM (ODS)
SEAT PAD - PARTIAL REPLACEMENT

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sorento (XMa)	September 24, 2009 to December 11, 2014

REQUIRED TOOL:

Tool Name	Part Number	Figure	Comments
Hong Ring Plier	09880 4F000A		Located in Drawer 10 of the SST Cabinet.

REQUIRED PART:

Part Name	Part Number	Figure	Qty.	Comments
ODS Sensor Pad	88950 1U500FFF		1	Non-ventilated
ODS Sensor Pad	88950 1U510FFF		1	Ventilated
Hog Ring 88200 1U100SAL	M0824 88049		3	Package contains 10 pieces.

WARRANTY INFORMATION:

N Code: I11 C Code: ZZ4

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	88204 1U000BD7 (13-15MY)	0	ODS Sensor Pad Partial Replacement	252A49R1	1.5 M/H	88950 1U500FFF (non-ventilated) OR 88950 1U510FFF (ventilated)	1
						M0824 88049	29
	88200 1U100SAL (11-12MY)	0	ODS Sensor Pad Partial Replacement ODS Sensor Pad Partial Replacement	252A49R0		88950 1U500FFF (non-ventilated) OR 88950 1U510FFF (ventilated)	1
						M0824 88049	29

AIR BAG LAMP ON DIAGNOSIS ONLY:

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
XMa (13-15MY)	W	88204 1U000BD7	0	KDS Operation ODS Sensor pad	252A49I0	0.2* M/H	N/A	0
XMa (11-12MY)		88200 1U100SAL						

***Airbag Illumination Diagnosis Only, does NOT include part replacement.**

Note: Refer to Warranty Extension Bulletin 2001 for claim submission procedures. For Substitute Transportation policy, please refer to [Service Policy and Procedures Manual \(SPPM\) 6.11 Kia Substitute Transportation](#).

