

Technical Journal

TITLE:

PS3 Step in Lights Flashing

REF NO: TJ 37362.1.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7515 Polestar		ISSUE DATE: 2025-10-09	STATUS DATE: 2025-10-27
FUNC GROUP: 3540	FUNC DESC: Llighting, interior	Page 1 of 3	

Attachment

File Name	File Size
TJ_37362_1.jpeg	0.2646 MB
TJ_37362_1.mov	1.3313 MB

DESCRIPTION:

If step-in lights are flashing, sometimes in alternating colours on one or more doors as attached movie TJ_37362_1.MOV, please follow advice under service.

CSC Customer Symptom Codes

Code	Description
JA	Passenger compartment lighting/Does not work

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
359							2024-2025		-	202402-202505

SERVICE:

1. Disconnect the affected step-in lamps from its connector and wait for one minute
2. Reconnect the lamp and then run the service function "Auto-addressing Interior Illumination" using VIDA.

If this resolves the issue, release the car to the customer.

Technical Journal 37362.1.0

If the issue persists, replace the affected step-in lights.

3. Remove the door panel as per Vida instructions.
4. Replace the affected step-in lights. Refer TJ_37362_1.jpeg
5. Run the service function "Auto-addressing Interior Illumination" using VIDA.

Please apply the VST operation number based on the number of lights replaced in the door. For example, if one light is replaced, use the operation once; if four lights are replaced, apply it four times.

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Please note that fault tracing is not eligible for separate reimbursement under this TJ. Any fault tracing VST operation numbers will be rejected.

Note that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
98801-2	General reimbursement acc. to TJ / Trouble shooting
98803-2	General reimbursement acc. to TJ / Light replacement

LABOR TIME:

Labor time subject to change without notice.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report Polestar" and sub concern area "Support not needed Polestar", use function group 3540.

To view TJ attachment continue to next page. This TJ has one attachment and one video file.

