

Preview Solution CBR-2514-2

Lost Communication to Alternator Message - DTC C103508

Published 11 November 2025

Valid For


Volvo Chassis - VN (4)

Mack Chassis - PR (4), AN (4)

Model Year - 2025 to current


A “**Lost Communication to Alternator**” message may be displayed, and **VMCU DTC C103508** may be active.

This condition is caused by a **software issue** in the VMCU.

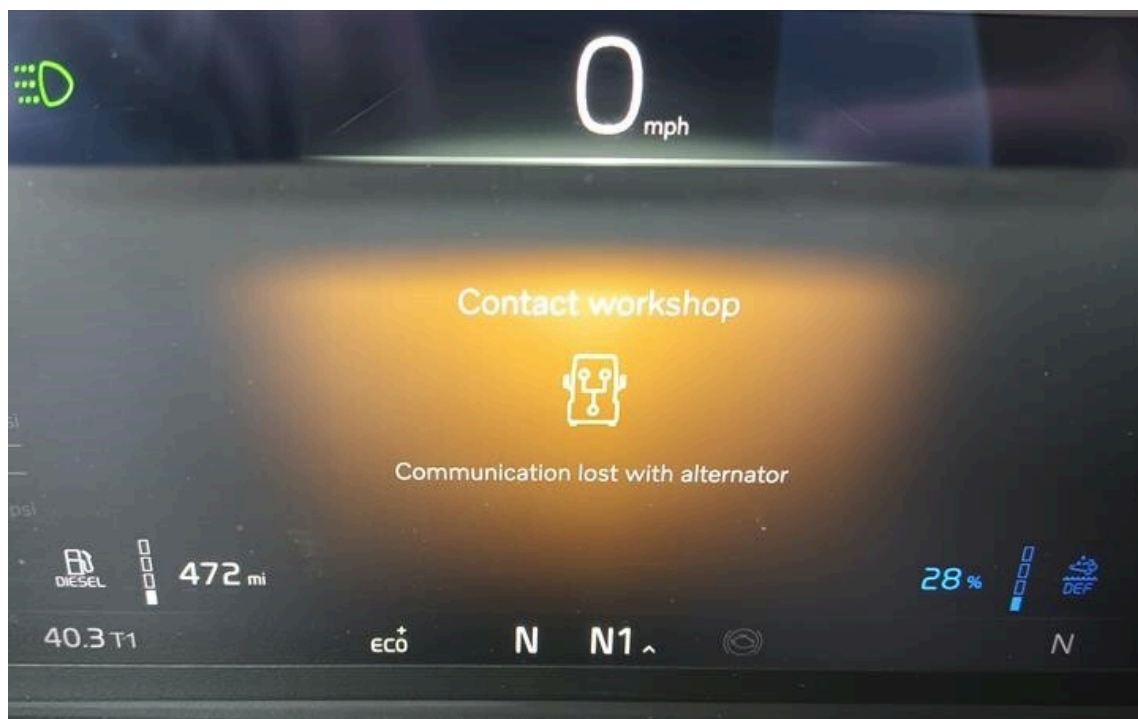

Correction Procedure

1. With the engine off.
2. Disconnect the alternator LIN connector. (Illustrated in RED)

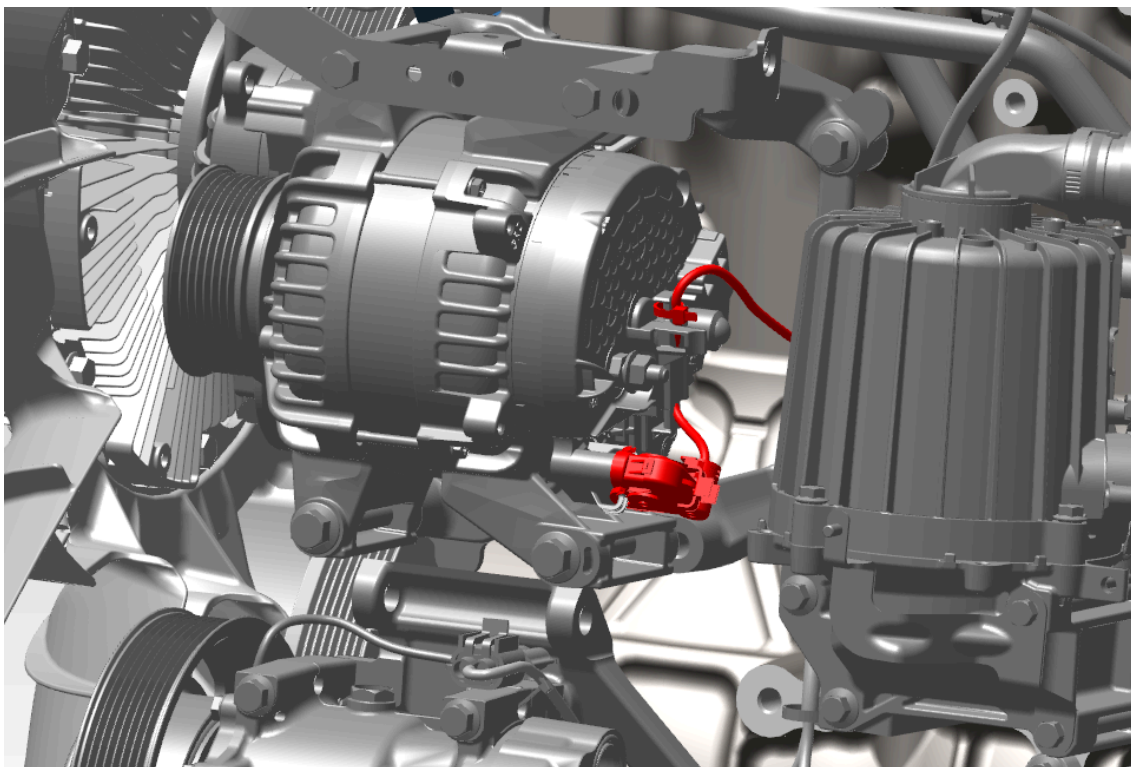

3. **Start and run engine** for approximately **3 minutes**.
4. **Shut down engine**.
5. **Reconnect the alternator LIN connector**.
6. **Check Diagnostic Trouble Code (DTC) C103508**.
 - The DTC should now display as **Inactive**.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article