

 Preview Solution CBR-2525-2

Exhaust Leak or Noise – Turbo Compound (TC) Bolt Inspection and Repair - VN (4), PR (4)

Published 10 November 2025

Valid For

Mack Chassis - PR (4)

Volvo Chassis - VN (4)


Model Year - 2025 to current

Complaint/Symptom:

Dealers or customers may report exhaust noise or exhaust leaks on Turbo Compound (TC) equipped trucks.

Cause:

Missing or loose bolts may be present in the exhaust collector section of the TC unit, leading to exhaust leaks or noise.

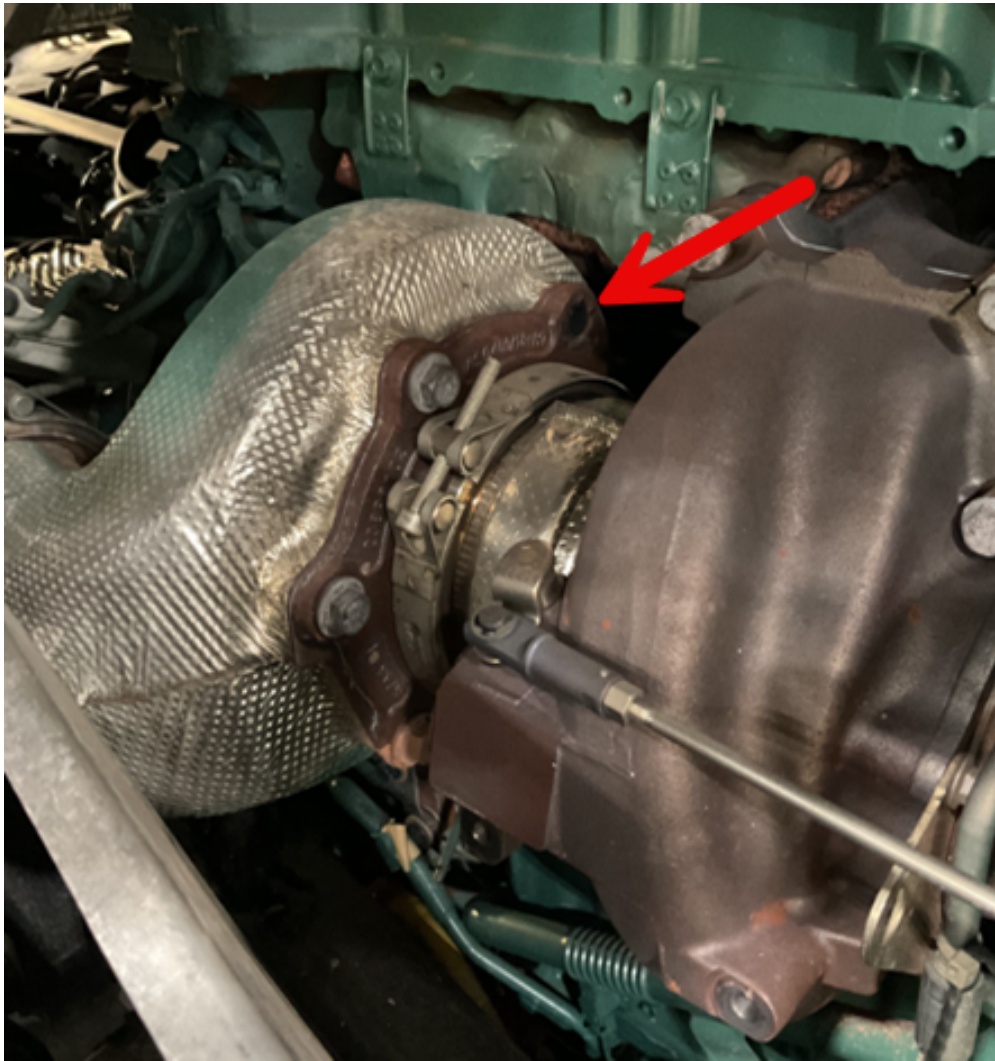

Correction:

1. Inspect the exhaust collector section of the TC unit for any missing or loose bolts.
2. If bolts are loose or missing, replace with new fasteners.
3. Use the following fastener for replacements:
 - **Part Number:** 24178977
 - **Description:** M12x30 Bolt with Micro- Encapsulated Locking Fluid
 - **Quantity:** As needed

Torque Specification:

- Torque to the specification listed in the appropriate service manual.

Related links and attachments

No links or attachments available

**Share**

to others that might find it helpful

**Feedback**

[Give feedback](#)

to help improve the content of this article