

 Preview Solution CBR-2527-1

Center Chassis Input Output Module (CCIOM) Fault Code U3000-94 - VN (4), PR (4)

Published 10 November 2025

Valid For

Mack Chassis - PR (4)

Volvo Chassis - VN (4)

Model Year - 2025 to current

Complaint/Symptom:

Fault code **U3000-94** active in the Center Chassis Input Output Module (CCIOM).

Cause:

The control unit may erroneously set DTC **U3000-94** when the response from the micro controller differs from what the software expects.

Correction:

1. Clear the fault code.
2. Turn the key **off** and wait **15 seconds**.
3. Turn the key **on**.
 - If the fault **returns and remains active**, follow **guided diagnostics in Tech Tool**.
 - If the fault **goes inactive**, **do not perform additional diagnostics**.

Additional Information:

A software update to address this erroneous fault will be included in a future software release.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

 Live UI

to help improve the content of this article