



Service Bulletin

Bulletin No.: PIT6459

Date: November, 2025

PRELIMINARY INFORMATION

Subject: DTC U0028 or U0037 Set In The K160 Brake System Control Module

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2026		ALL	ALL	ALL	ALL
Cadillac	Escalade ESV	2026		ALL	ALL	ALL	ALL
Chevrolet	Silverado EV	2026		ALL	ALL	ALL	ALL
Chevrolet	Suburban	2026		ALL	ALL	ALL	ALL
Chevrolet	Tahoe	2026		ALL	ALL	ALL	ALL
GMC	Sierra EV	2026		ALL	ALL	ALL	ALL
GMC	Yukon	2026		ALL	ALL	ALL	ALL
GMC	Yukon XL	2026		ALL	ALL	ALL	ALL

Involved Region or Country	North America
Condition	Some technicians may encounter a DTC: U0028 symptom 88 and/or U0037 symptom 88 set in the K160 Brake System Control Module
Cause	If a technician encounters DTC U0028 sym88 and/or U0037 sym88 during diagnostic testing, these codes may report to the incorrect diagnostic path due to a software anomaly within the K160 Brake System Control Module.

Correction

A SW update is planned to be released for this issue in Q1 of 2026.

In the interim, if a technician encounters either U0028-88 or U0037-88 during diagnostic testing, they should utilize the opposite DTC diagnostic procedure in SI.

If the vehicle has U0028-88 then use the diagnostic for U0037-88

If the vehicle has U0037-88 then use the diagnostic for U0028-88

This PI will be updated once the SW has been released into SPS.

Version	1
Modified	11/25/2025 — Created.

